GE
Measurement & Control Solutions

Moisture

Moisture Target™ Series 6

Hygrometer

User's Manual

imagination at work

910-291 Rev. D
December 2011

GE
Measurement & Control Solutions

Moisture Target™ Series 6

Hygrometer

User's Manual

910-291 Rev. D
December 2011

www.ge-mcs.com

©2011 General Electric Company. All rights reserved.
Technical content subject to change without notice.

[no content intended for this page]

Information Paragraphs

- **Note** *paragraphs provide information that provides a deeper understanding of the situation, but is not essential to the proper completion of the instructions.*
- **Important** *paragraphs provide information that emphasizes instructions that are essential to proper setup of the equipment. Failure to follow these instructions carefully may cause unreliable performance.*
- **Caution!** paragraphs provide information that alerts the operator to a hazardous situation that can cause damage to property or equipment.
- **Warning!** paragraphs provide information that alerts the operator to a hazardous situation that can cause injury to personnel. Cautionary information is also included, when applicable.

Safety Issues

WARNING! It is the responsibility of the user to make sure all local, county, state and national codes, regulations, rules and laws related to safety and safe operating conditions are met for each installation.

Auxiliary Equipment

Local Safety Standards

The user must make sure that he operates all auxiliary equipment in accordance with local codes, standards, regulations, or laws applicable to safety.

Working Area

WARNING! Auxiliary equipment may have both manual and automatic modes of operation. As equipment can move suddenly and without warning, do not enter the work cell of this equipment during automatic operation, and do not enter the work envelope of this equipment during manual operation. If you do, serious injury can result.

WARNING! Make sure that power to the auxiliary equipment is turned OFF and locked out before you perform maintenance procedures on the equipment.

Qualification of Personnel

Make sure that all personnel have manufacturer-approved training applicable to the auxiliary equipment.

Personal Safety Equipment

Make sure that operators and maintenance personnel have all safety equipment applicable to the auxiliary equipment. Examples include safety glasses, protective headgear, safety shoes, etc.

Unauthorized Operation

Make sure that unauthorized personnel cannot gain access to the operation of the equipment.

Environmental Compliance

Waste Electrical and Electronic Equipment (WEEE) Directive

GE Measurement & Control Solutions is an active participant in Europe's *Waste Electrical and Electronic Equipment* (WEEE) take-back initiative, directive 2002/96/EC.

The equipment that you bought has required the extraction and use of natural resources for its production. It may contain hazardous substances that could impact health and the environment.

In order to avoid the dissemination of those substances in our environment and to diminish the pressure on the natural resources, we encourage you to use the appropriate take-back systems. Those systems will reuse or recycle most of the materials of your end life equipment in a sound way.

The crossed-out wheeled bin symbol invites you to use those systems.

If you need more information on the collection, reuse and recycling systems, please contact your local or regional waste administration.

Visit **http://www.ge-mcs.com/en/about-us/environmental-health-and-safety/1741-weee-req.html** for take-back instructions and more information about this initiative.

Chapter 1. Features and Capabilities

1.1 Introduction 1
1.2 Electronics Unit 1
1.3 Probes 2

Chapter 2. Installation

2.1 Introduction 3
2.2 Selecting the Recorder Output 4
2.3 Mounting the Electronics Unit 8
2.3.1 Basic Mounting 8
2.3.2 Adapter Plate Mounting 12
2.4 Mounting the Sample System 16
2.5 Installing the Probe 17
2.6 Wiring the System 18
2.6.1 Connecting a Standard Probe 21
2.6.2 Connecting a VeriDri Probe 24
2.6.3 Connecting the Recorder Outputs 27
2.6.4 Connecting the Relays 27
2.6.5 Installing the AC Power Cable 30
2.6.6 Installing the DC Power Cable 31

Chapter 3. Operation and Programming

3.1 Using the MTS6 33
3.1.1 Starting Up 33
3.1.2 Accessing the Menus 34
3.1.3 Entering Numeric Values 35
3.2 Setting Up the Display 36
3.2.1 Selecting Primary Units 36
3.2.2 Setting Decimal Places 37
3.2.3 Contrast 37
3.3 Setting Up the Output 38
3.3.1 Entering the Output Menu 38
3.3.2 Selecting Output Units 38
3.3.3 Selecting an Output Type 39
3.3.4 Changing the Upper Output Span 39
3.3.5 Changing the Lower Output Span 40
3.3.6 Testing the Output 40
3.3.7 Trimming the Outputs 41
3.4 Setting Up Alarms 43
3.4.1 Selecting an Alarm Output 43
3.4.2 Selecting Alarm Status 43
3.4.3 Selecting Alarm Units 44
3.4.4 Selecting an Alarm Type 44
3.4.5 How the Alarm Types Work 45
3.4.6 Changing the Upper Alarm Span 46
3.4.7 Changing the Lower Alarm Span 46
3.4.8 Testing the Alarm Relays 47
3.5 Logging 47
3.5.1 Checking the Data Log Status 47
3.5.2 Log Settings Menu 48
3.5.3 Managing Log Files 51
3.5.4 Ejecting the SD Card 55
3.5.5 Viewing Data Logs 55
3.6 Setting Other Information 56
3.6.1 Entering the Passcode 56
3.6.2 Setting the Fault Alarm 56
3.6.3 Setting Autocal 59
3.6.4 Setting Calibration Data 1 60

3.6.5 Setting Calibration Data 2 63
3.6.6 Reading and Setting the Calibration References 65
3.6.7 Entering the M Series Probe Serial Number 67
3.6.8 Setting the Volume Mixing Ratio 68
3.6.9 Resetting the Time 70
3.6.10 Selecting the Probe Type 73
3.6.11 Setting a Constant DP °C Offset 74
3.7 Viewing System Information 75
3.7.1 Checking the ID 75
3.7.2 Checking the Status 75
3.7.3 Checking the Software Version 76
3.7.4 Checking the Probe 76
3.7.5 Checking the Wiring 77
3.8 Locking the Menu 77

Chapter 4. Service and Maintenance

4.1 Introduction 81
4.2 Common Problems 81
4.3 Replacing/Recalibrating Moisture Probes 83
4.4 Cleaning the MTS6 Front Panel 84

Chapter 5. Specifications

5.1 Electronics 85
5.2 Moisture Measurement 87

Appendix A. Outline and Installation Drawings

Appendix B. Menu Maps

Appendix C. Reading the MicroSD Card

C.1 Removing the Card 97
C.2 Accessing the Files 100
C.3 Setting Up the Files 103

Appendix D. The Non-Enclosure MTS6 Package

[no content intended for this page]

Chapter 1. Features and Capabilities

1.1 Introduction

The *Moisture Target Series 6* (**MTS6**) is a microprocessor-based, single-channel hygrometer that measures moisture content in gases. It is intended for *Original Equipment Manufacturer* (**OEM**) applications, and is suitable for a wide range of process conditions that require real-time moisture measurement.

The **MTS6** accepts any calibration range provided with GE probes (see Chapter 5, *Specifications* for more information). It comes equipped with two standard alarm relays, one fault alarm relay, and a single analog output. It also has onboard data logging capability using an micro SD card.

1.2 Electronics Unit

The **MTS6** displays measurement data on a liquid crystal display (**LCD**). You can program your unit and enter probe information using the keys on the front panel (see Figure 1). The **MTS6** accepts line voltages of a universal power supply from 100 to 240 VAC, or 24 VDC, depending on what is ordered.

Figure 1: Front Panel

1.3 Probes

The *moisture probe* is the part of the system that comes in direct contact with the process. The **MTS6** uses any GE M Series (see Figure 2) or a VeriDri probe (see Figure 3) to measure dew point temperature in °C or °F. The sensor assembly is secured to the probe mount and is protected with a sintered stainless steel shield (see Figure 2).

Note: *Other types of shields are available upon request.*

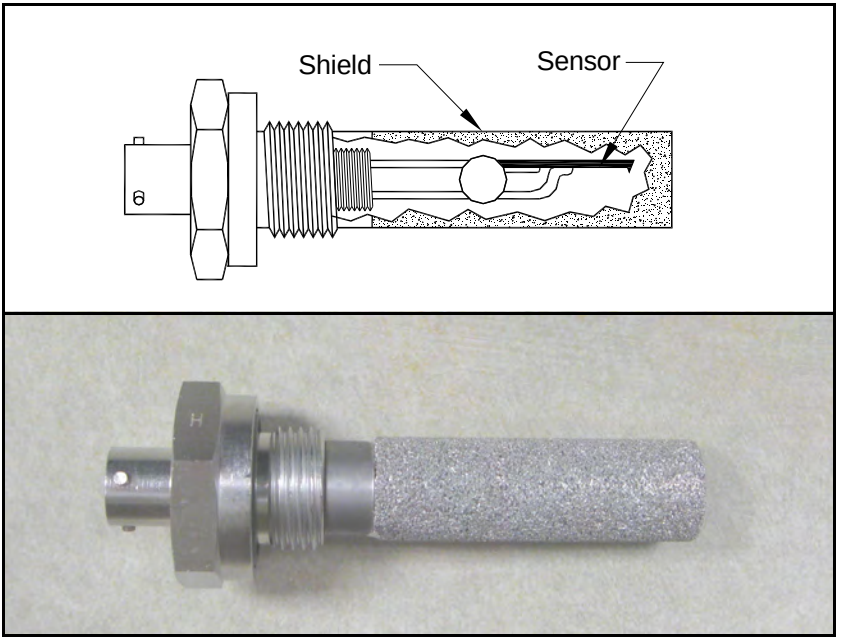

Figure 2: M Series Probe

Figure 3: VeriDri Probe

Chapter 2. Installation

2.1 Introduction

Installing the **MTS6** includes the following steps:

- selecting the recorder output
- mounting the electronics unit
- mounting the sample system
- installing the probe into the sample system
- wiring the input power
- wiring the probe and alarm connections

WARNING! To ensure safe operation, the MTS6 must be panel mounted and operated as described in this manual. Also, be sure to follow all applicable local safety codes and regulations for installing electrical equipment.

Note: *For the non-enclosure MTS6 package, please refer to Appendix D for mounting and installation.*

2.2 Selecting the Recorder Output

Note: *By default, the recorder is set to the current output.*

Note: *The customer will provide their own cable for connecting the recorder. Acceptable cables range from 16 to 26AWG.*

The **MTS6** has one isolated analog recorder output. The recorder output provides either a current or voltage signal, which is set by switch **S1** on the main PC board.

Complete these steps to check or reset switch **S1** (see Figure 8 on page 7).

WARNING! Never connect line voltage or any other power input to the recorder output terminals.

1. Make sure the **MTS6** is turned off and unplugged.

WARNING! The MTS must be isolated or disconnected from all voltage sources before changing the recorder output.

2. Remove the screw at the top of the back panel (see Figure 4).

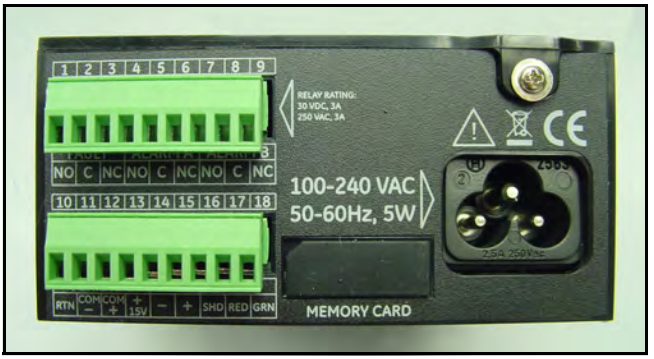
1 2 3 4 5 6 7 8 9
NO C NC NO C NC NO C NC
10 11 12 13 14 15 16 17 18
RELAY RATING:
30 VDC, 3A
250 VAC, 3A
100-240 VAC
50-60Hz, 5W
RTN COM COM + 15V - + SHD RED GRN
MEMORY CARD

Figure 4: Back Panel

2.2 Selecting the Recorder Output (cont.)

3. Lift the back edge of the cover (see Figure 5), slide the cover back (see Figure 6), and lift it from the enclosure (see Figure 7 on page 6).

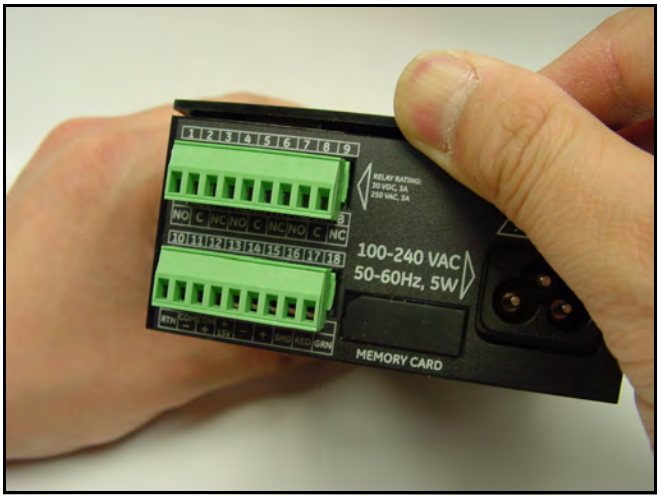

Figure 5: Lifting the Back Edge of the Cover

Figure 6: Sliding the Cover Back

2.2 Selecting the Recorder Output (cont.)

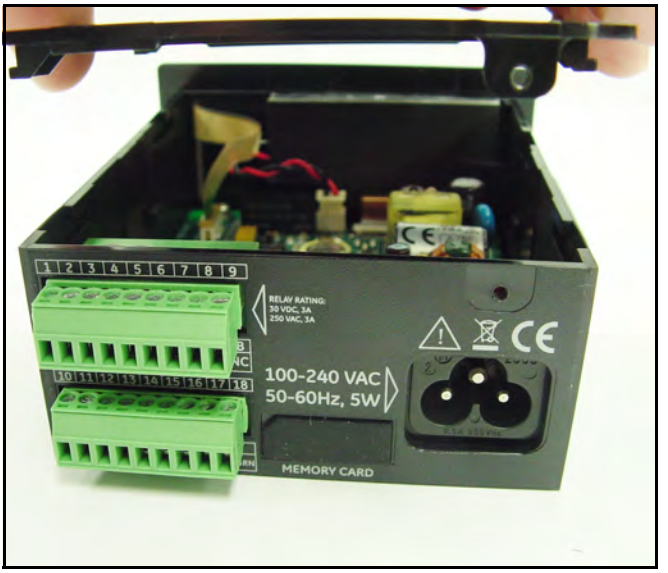

Figure 7: Lifting the Cover

2.2 Selecting the Recorder Output (cont.)

4. Locate switch **S1** (see Figure 8, highlighted area).

CAUTION! Use proper ESD grounding prior to changing the switch.

5. Set switch **S1** to the desired position: **V** for voltage or **I** for current.

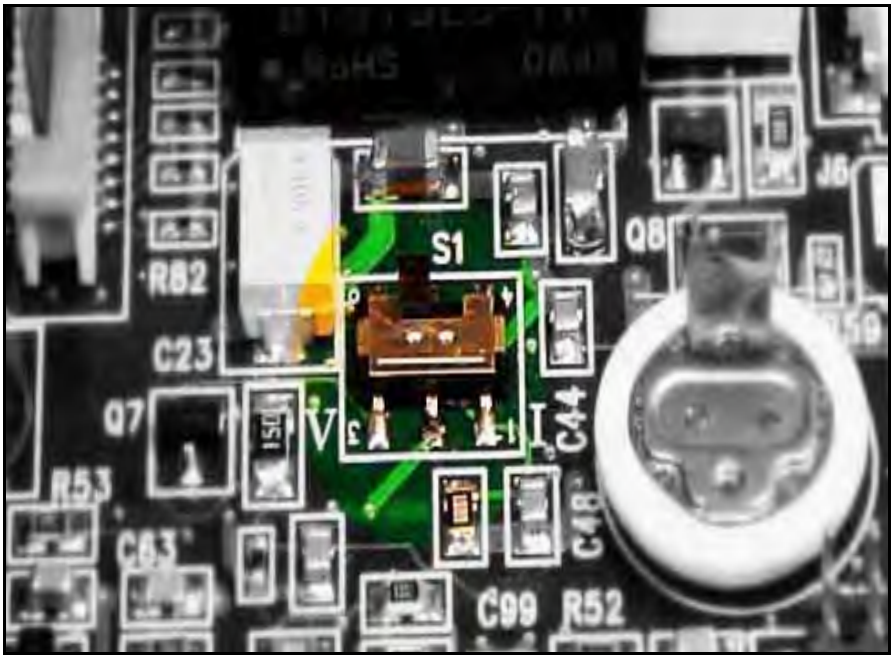

Figure 8: Switch S1 on the Main PC Board

6. After setting the switch, replace the cover and reinsert the rear enclosure screw.

2.3 Mounting the Electronics Unit

The **MTS6** unit can be installed in a panel up to 0.25 in. (6 mm) thick. See Appendix A, *Outline and Installation Drawings*, for the required panel cutout dimensions.

IMPORTANT: *For* **NEMA 4** *and* **IP66** *installation, the* **MTS6** *must be mounted in a rigid, flat panel using the panel gasket and both mounting brackets provided.*

2.3.1 Basic Mounting

To mount the **MTS6** in a panel with a basic 94 mm (3.69”) x 46 mm (1.81”) opening, refer to the following figures and complete the following steps:

1. Remove the side panel mount label prior to installation.

Figure 9: Removing Side Panel Mount Label

2.3.1 Basic Mounting (cont.)

2. Slide the small gasket along the **MTS6** and place it around the back of the display (see Figure 10).

Figure 10: Installing the Gasket Behind the Display

3. Slide the **MTS6** into the panel cutout (see Figure 11).

Figure 11: Sliding the MTS6 into the Panel Cutout

2.3.1 Basic Mounting (cont.)

4. Behind the panel, insert the mounting brackets into the side holes provided (see Figure 12).

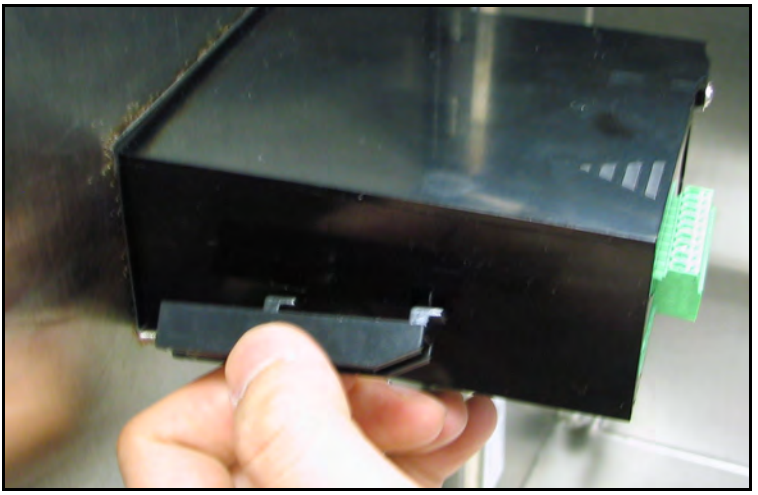

Figure 12: Installing the Mounting Brackets

5. Hold the chassis and lock each mounting bracket in place by sliding it toward the rear of the **MTS6** (see Figure 13).

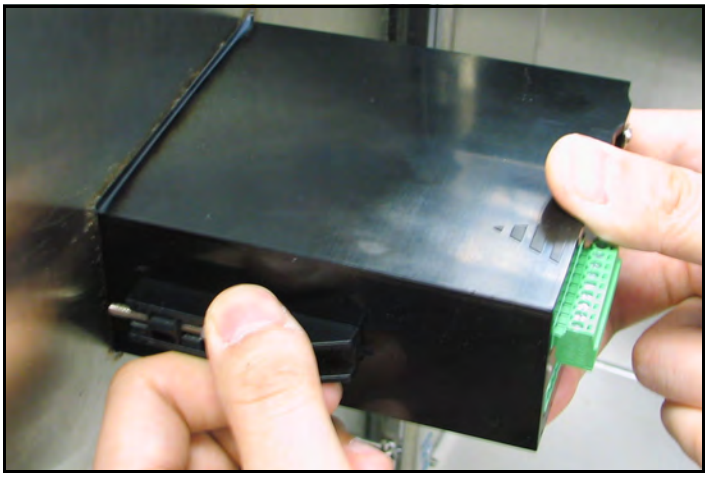

Figure 13: Locking the Mounting Brackets in Place

2.3.1 Basic Mounting (cont.)

6. Use a screwdriver to extend the bracket screws to the back of the panel and secure the **MTS6** in the panel cutout (see Figure 14).

Figure 14: Securing the MTS6 to the Panel

7. Using a feeler gauge behind the gasket, check the compression, and tighten the bracket screws until the gap is 0.028” ±0.002” (see Figure 15).

Figure 15: Checking the Gasket Compression

2.3.2 Adapter Plate Mounting

Some customers may need to retrofit an **MTS6** into a cut-out sized for GE's previous OEM panel-mount hygrometers: MTS5, MTS4 or PanaDry models. The previous generations were of a larger size requiring a 5.40" (137.2 mm) W x 2.65" (67.3 mm) H cut-out. The **MTS6** is smaller, requiring a 3.69" (94 mm) W x 1.81" (46 mm) H cut-out. For those customers who need to retrofit the larger panel cut-out sizes, GE offers an optional adapter plate. See Appendix A, *Outline and Installation Drawings*, for the required panel cutout.

1. Fit the larger gasket around the adapter plate (see Figure 16).

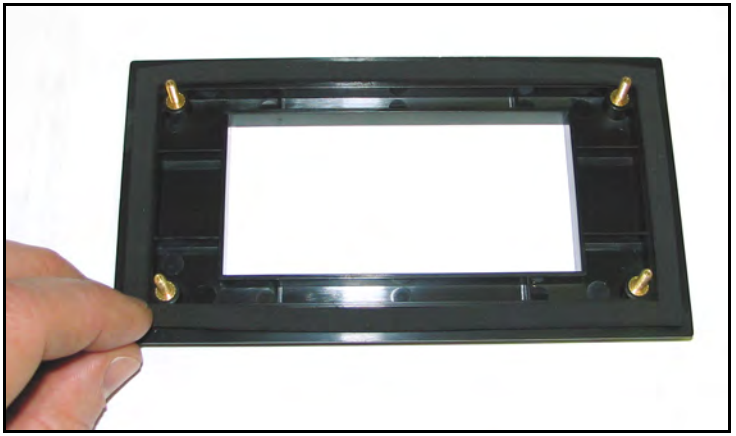

Figure 16: Installing the Adapter Plate Gasket

2.3.2 Adapter Plate Mounting (cont.)

2. Fit the adapter plate into the panel cutout (see Figure 17).

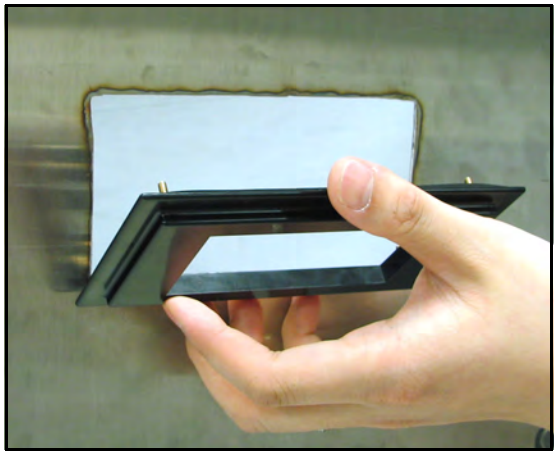

Figure 17: Inserting the Adapter Plate

3. Behind the panel, place the metal backing plate over the four adapter plate mounting screws (see Figure 18).

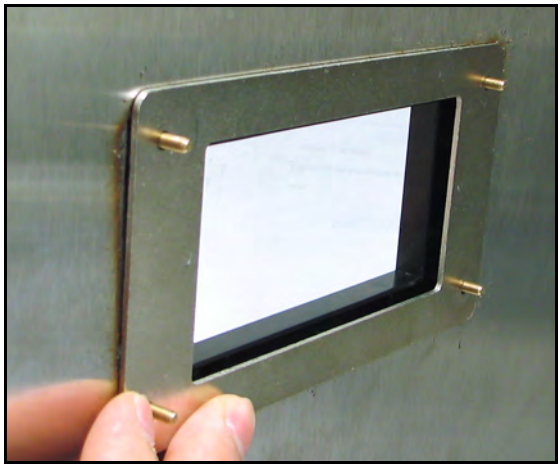

Figure 18: Applying the Backing Plate

2.3.2 Adapter Plate Mounting (cont.)

4. Apply nuts to the four screws and secure the assembly to the panel (see Figure 19 and Figure 20). Use a feeler gauge behind the gasket, check the compression, and tighten the nuts until the gap is 0.032” ±0.002”.

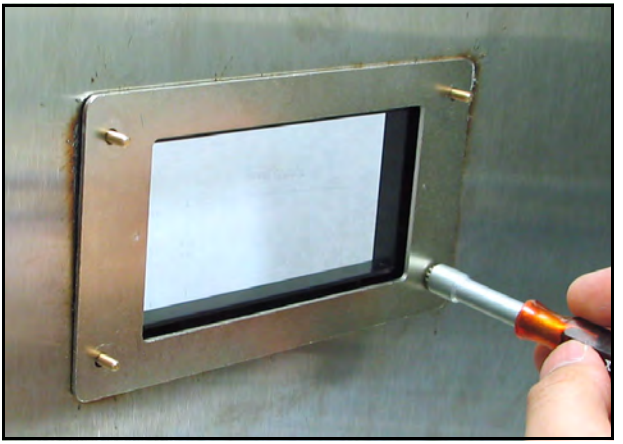

Figure 19: Securing the Assembly to the Panel

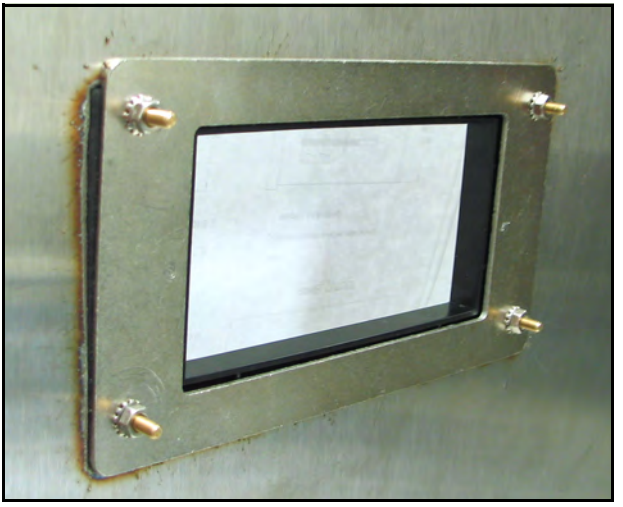

Figure 20: Plate Assembly Mounting Complete

2.3.2 Adapter Plate Mounting (cont.)

Now mount the **MTS6** using steps 1-6 in *Basic Mounting* on page 8. Re-verify the adapter plate gap after the **MTS6** is mounted to the adapter plate. The installation should appear similar to Figure 21 and Figure 22.

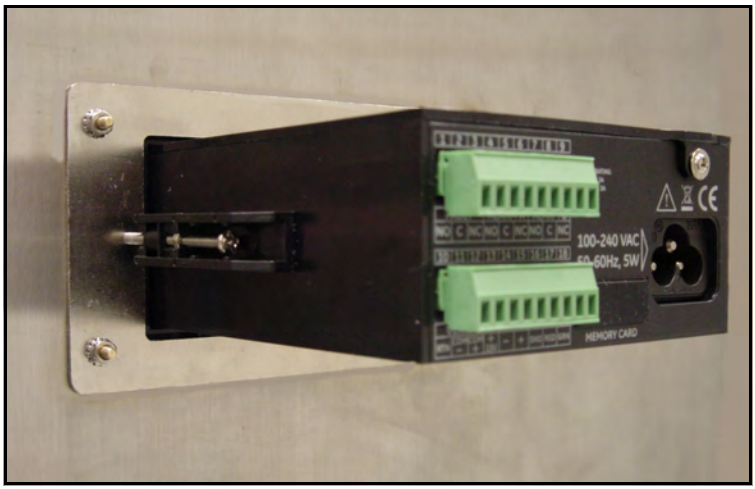

Figure 21: MTS6 Installation with Adapter Plate - Rear

Figure 22: MTS6 Installation with Adapter Plate - Front

2.4 Mounting the Sample System

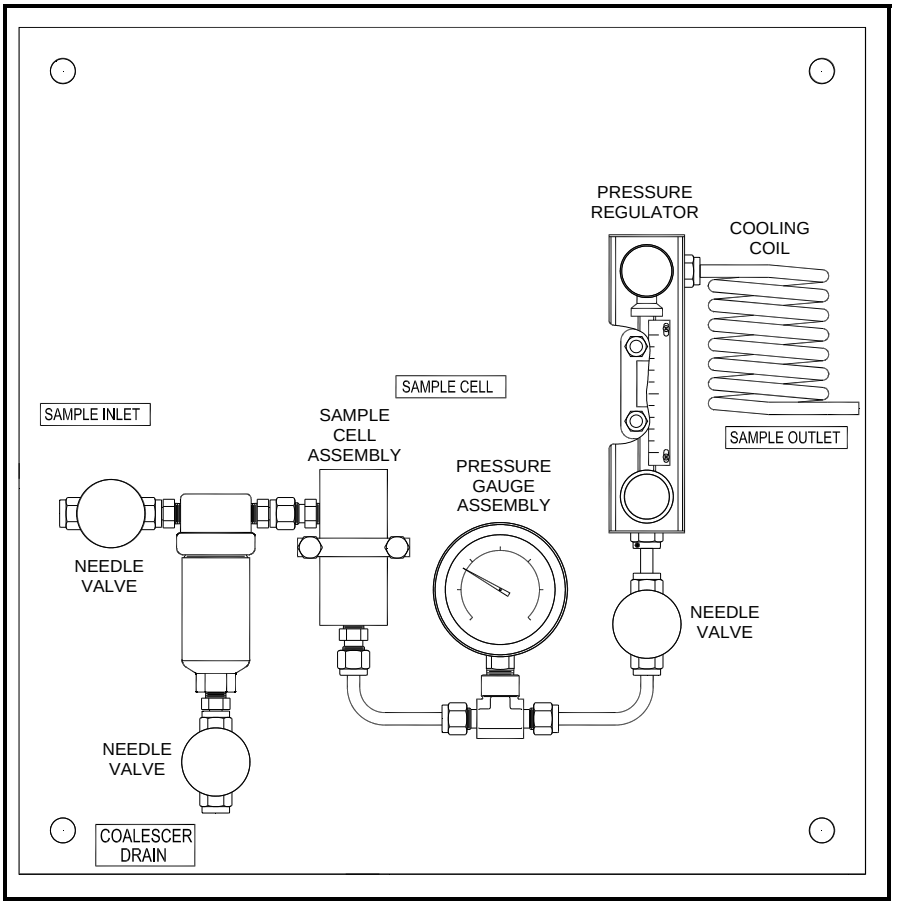

Figure 23: Typical Sample System

2.4 Mounting the Sample System (cont.)

The sample system is normally fastened to a flat metal plate that has four mounting holes. Upon request, GE can also provide the sample system in an enclosure.

Complete the following steps to mount the sample system:

1. Fasten the sample system plate or enclosure to a vertical wall or panel with a bolt in each of the four corners.
2. Connect the sample system inlet to the process and the outlet to the return, using appropriate stainless steel fittings and tubing.

CAUTION! Do not start the process flow through the system until the probe has been properly installed (see the following section).

2.5 Installing the Probe

GE probes are usually installed in a sample system to protect the probe from any damaging elements in the process. The probe is mounted in a cylindrical container called the **sample cell**, which is included as part of your sample system.

Standard M2 probes and VeriDri probes are mounted into the sample system or process line with 3/4-16 straight threads that are sealed with an o-ring. Other fittings are available for special applications.

CAUTION! If the probe is to be mounted directly in the process line, without a sample system, consult GE for proper installation instructions and precautions.

Refer to Figure 24 on page 18, and complete these steps to install the probe into the sample cell:

1. Insert the probe into the sample cell and thread the probe into the sample cell fitting. Make sure you do not to cross the threads.
2. Tighten the probe securely.

2.5 Installing the Probe (cont.)

3. Identify the sample cell inlet port as the connection that is perpendicular to the installed probe.

CAUTION! For maximum protection of the aluminum oxide sensor, the probe shield should always be left in place.

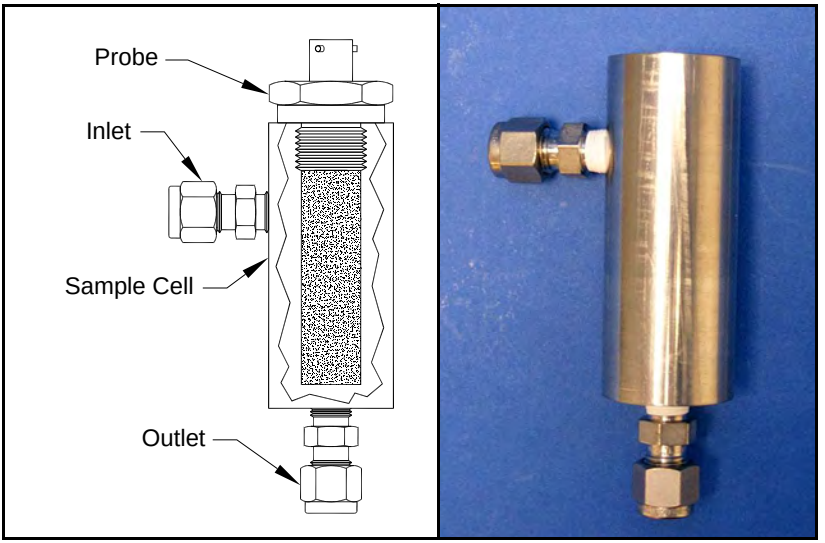

Figure 24: Probe/Sample Cell Assembly

2.6 Wiring the System

Wiring the **MTS6** system includes the following steps:

- connecting the probe
- connecting the recorder output
- connecting the alarms
- installing the power cable

WARNING! To ensure safe operation, the MTS6 must be installed and operated as described in this manual. Also, be sure to follow all applicable local safety codes and regulations for installing electrical equipment.

2.6 Wiring the System (cont.)

The **CAUTION!** symbol is a reminder that **MTS6** components can be damaged if electrical connections are not correctly made.

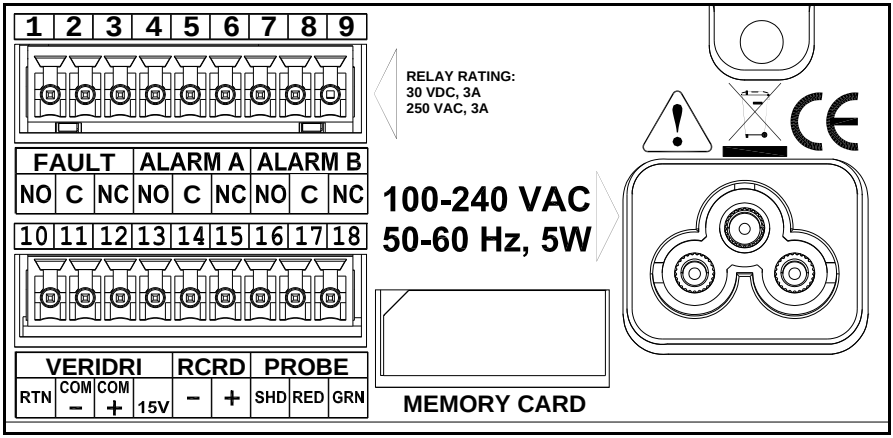

Figure 25: MTS6 Rear Panel Connections - AC Version

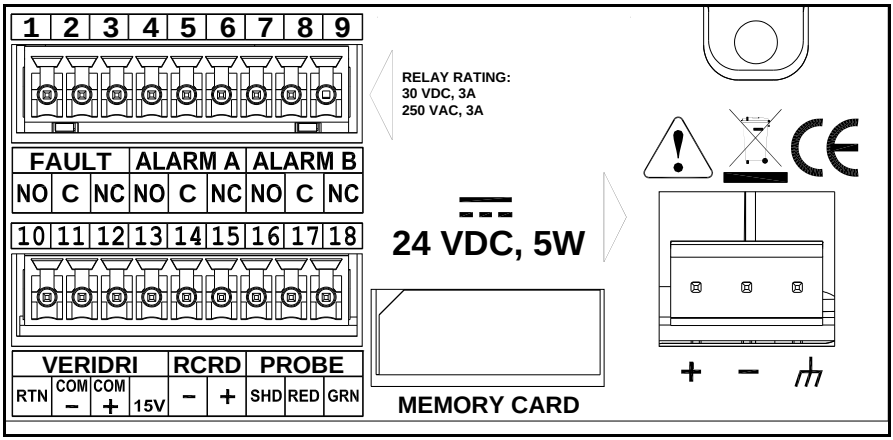

Figure 26: MTS6 Rear Panel Connections - DC Version

2.6 Wiring the System (cont.)

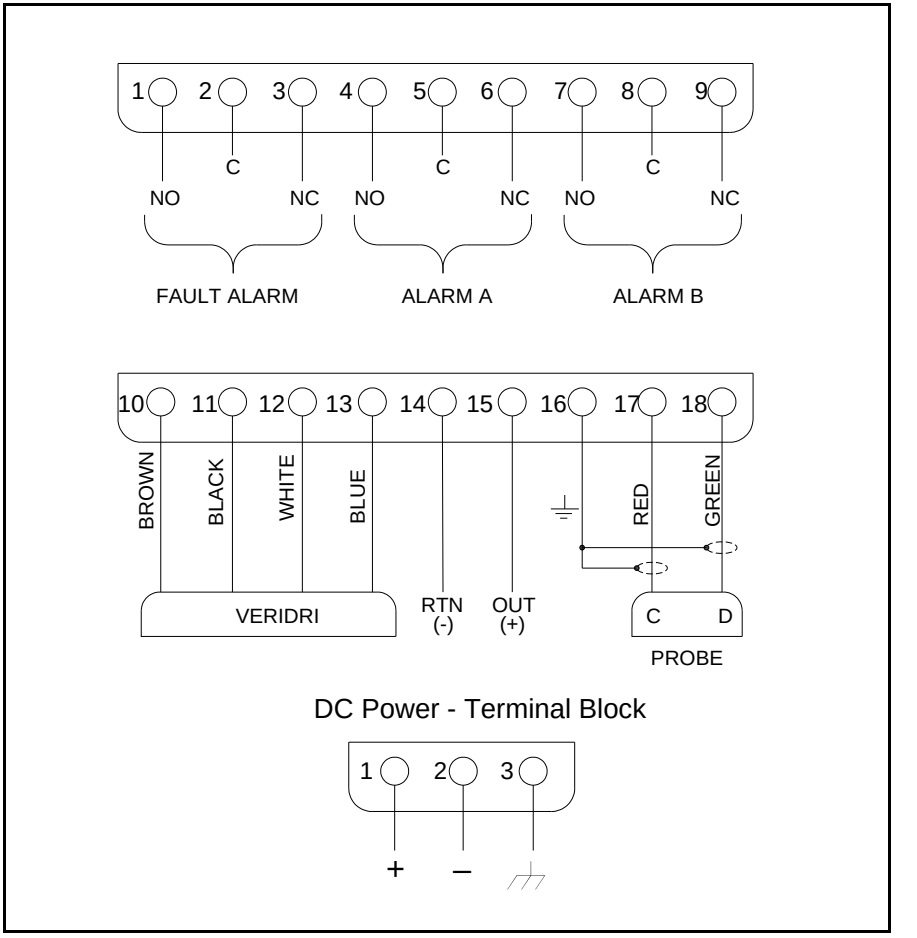

Figure 27: MTS6 Wiring Diagram

2.6.1 Connecting a Standard Probe

The probe must be connected to the **MTS6** with a continuous run of GE *two-wire shielded cable*. When connecting the probe, protect the cable from excessive strain (bending, pulling, etc.) and avoid subjecting the cable to temperatures above 65°C (149°F) or below –50°C (–58°F).

Note: *Standard factory-assembled cables are available from GE in lengths up to 600 meters (2000 feet).*

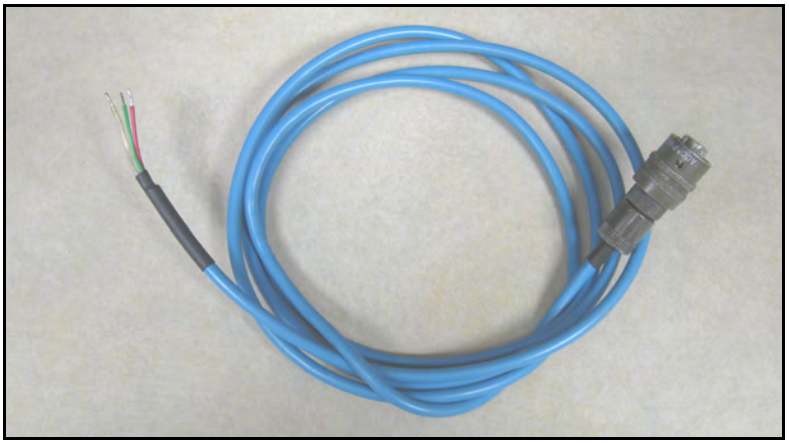

Figure 28: Two-Wire, Shielded, M Series Probe Cable

To connect the probe cable, refer to Figure 25 on page 19 and Figure 29 and Figure 30 on page 22, and complete the following steps:

1. Insert the end of probe cable with the bayonet-type connector onto the probe and twist the shell clockwise until it snaps into a locked position (approximately 1/8 turn).

IMPORTANT: *Ensure that the power is off before proceeding.*

2. Connect the end of the probe cable with the three leads to the lower terminal block (pins 16, 17 and 18) on the back of the **MTS6**.

2.6.1 Connecting a Standard Probe (cont.)

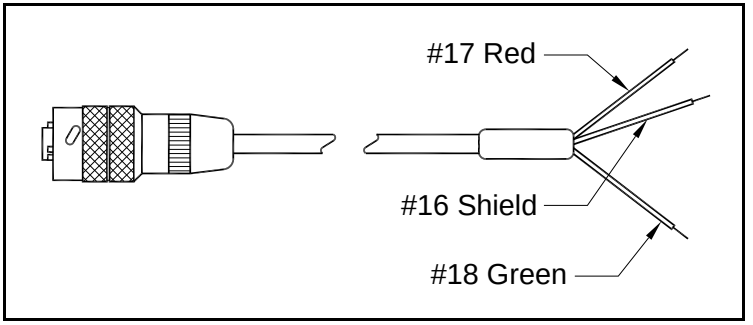

Figure 29: M Series Probe Cable Connections

IMPORTANT: *To maintain good contact at the terminal block and to avoid damaging the pins on the wiring connector, pull the connector straight off (not at an angle) the terminal block. Then, make the cable connections while the connector is off the unit. Finally, after the wiring is complete, push the connector straight onto the terminal block (not at an angle).*

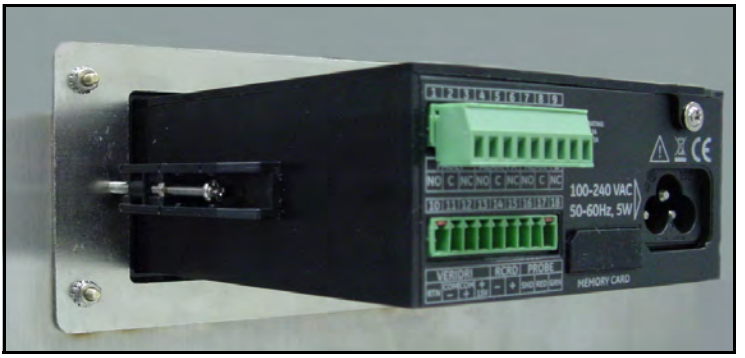

Figure 30: Bottom Connector Removed

2.6.1 Connecting a Standard Probe (cont.)

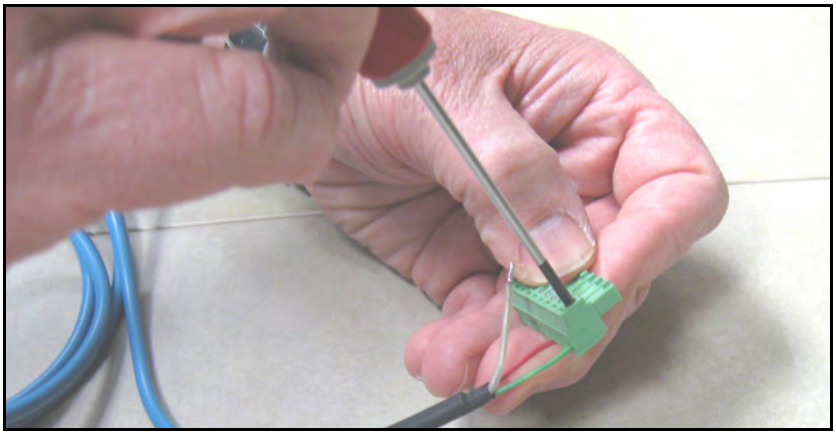

Figure 31: Making Probe Cable Connections to the Connector

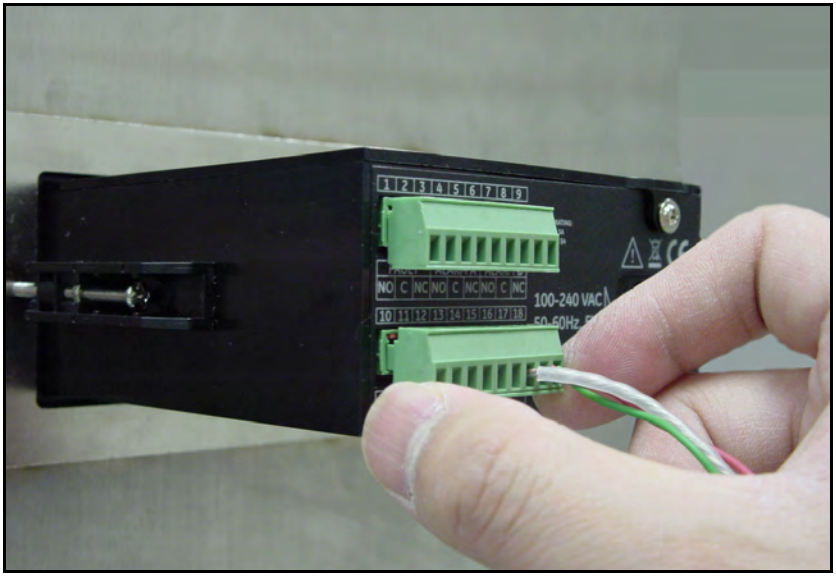

Figure 32: Reinserting the Connector into the Terminal Block

2.6.2 Connecting a VeriDri Probe

Use the following steps to wire the **VeriDri** to the **MTS6**.

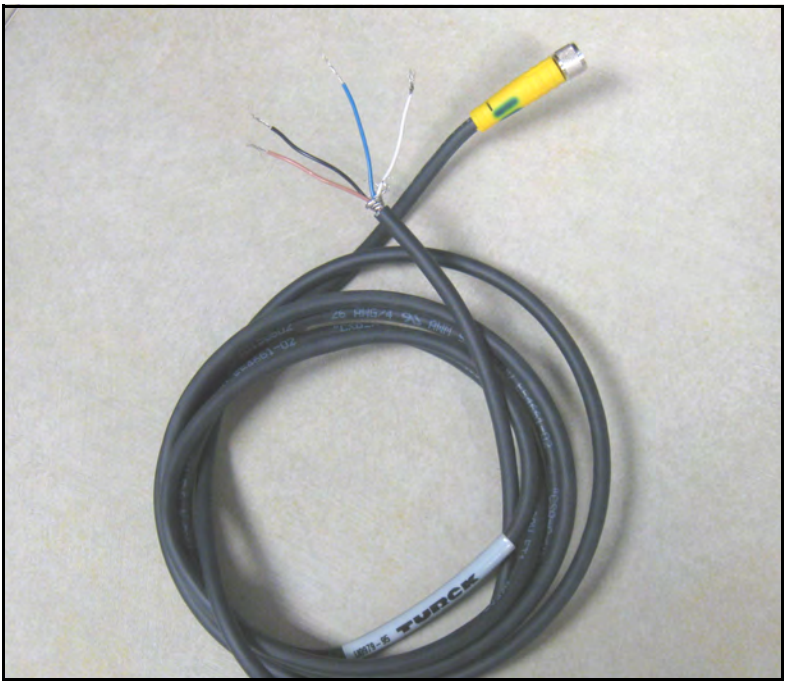

Figure 33: Four-Wire, VeriDri Probe Cable

1. Insert the end of probe cable with the connector onto the probe and twist the connector head clockwise until it is secure.

IMPORTANT: *Ensure that the power is off before proceeding.*

2.6.2 Connecting a VeriDri Probe (cont.)

2. Using the flying leads at the end of the **VeriDri** cable, connect the probe to the lower terminal block (pins 10, 11, 12 and 13) on the back of the **MTS6** (see Table 1 and Figure 35 and Figure 36 on page 26).

Table 1: VeriDri Wiring Connections

Wire Color	Pin Number	Designation
Brown	10	RTN
Black	11	COM –
White	12	COM +
Blue	13	+15V

IMPORTANT: *To maintain good contact at the terminal block and to avoid damaging the pins on the wiring connector, pull the connector straight off (not at an angle) the terminal block. Then, make the cable connections while the connector is off the unit. Finally, after the wiring is complete, push the connector straight onto the terminal block (not at an angle).*

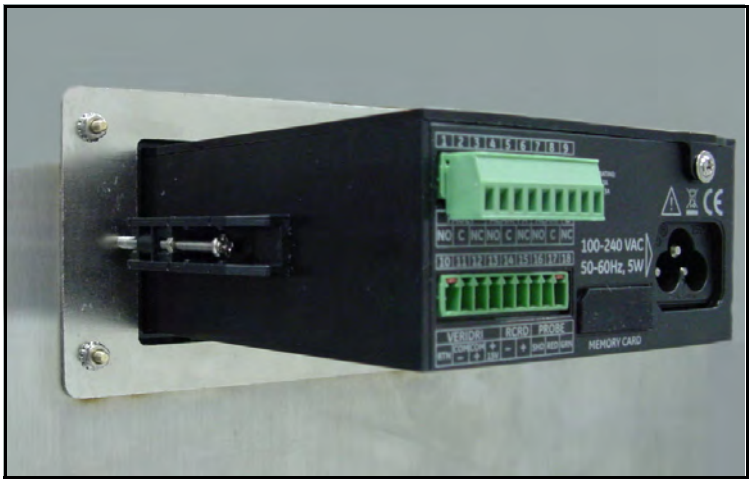

Figure 34: Bottom Connector Removed

2.6.2 Connecting a VeriDri Probe (cont.)

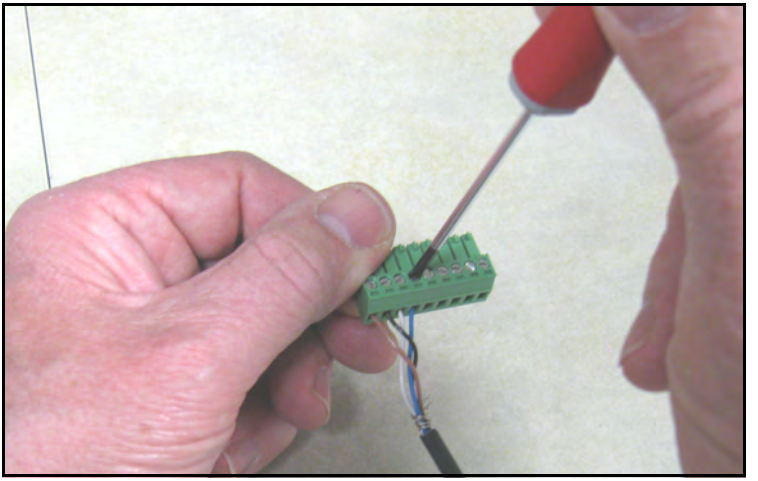

Figure 35: Wiring the Cable to the Connector

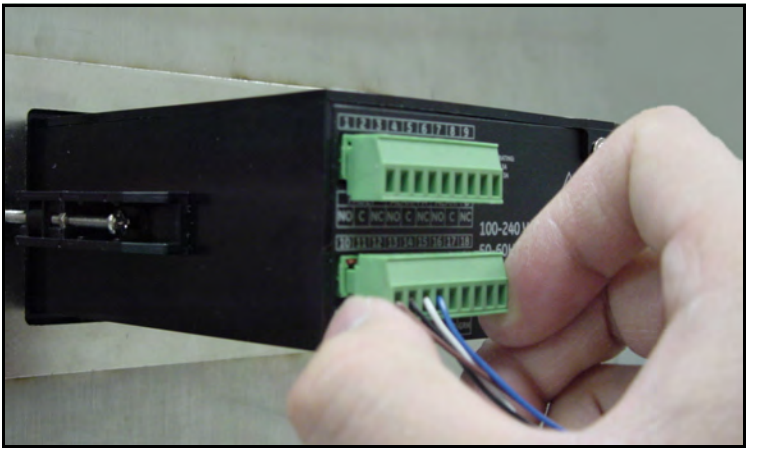

Figure 36: Reinserting the Connector into the Terminal Block

Note: *When there is a* No Link *error for the* **VeriDri**, *check the wiring to ensure proper connections and make sure there is no short between the* +15V *and* RTN.

2.6.3 Connecting the Recorder Outputs

IMPORTANT: *Ensure that the power is off before proceeding.*

Connect your recorder to the lower terminal block on the back of the **MTS6** (pins 14 and 15), as shown in Figure 25 and Figure 26 on page 19.

IMPORTANT: *To maintain good contact at each terminal block and to avoid damaging the pins on the connector, pull the connector straight off (not at an angle), make cable connections while the connector is away from the unit, and push the connector straight on (not at an angle) when the wiring is complete.*

2.6.4 Connecting the Relays

Note: *The customer will provide their own cable for connecting the alarm relays. Acceptable cables range from 16 to 26AWG.*

The **MTS6** has one fault alarm relay and two high/low alarm relays. Each alarm relay is a single-pole, double-throw contact set that contains the following contacts:

- Normally Open (**NO**)
- Common (**C**)
- Normally Closed (**NC**)

Table 2: Pin Designations for Relay Contacts

	Fault	Alarm A	Alarm B
Normally Open	1	4	7
Common	2	5	8
Normally Closed	3	6	9

2.6.4a Connecting the High/Low Alarms (A and B)

IMPORTANT: *Ensure that the power is off before proceeding.*

Each of these alarms can be set to trip on either a high or low condition. For a high alarm, the alarm will trip if the input exceeds the setpoint. For a low alarm, the alarm will trip if the input drops below the setpoint. Make connections to the Alarm A and Alarm B upper terminal block on the back of the **MTS6**, as shown in Figure 25 and Figure 26 on page 19.

IMPORTANT: *To maintain good contact at each terminal block and to avoid damaging the pins on the connector, pull the connector straight off (not at an angle), make cable connections while the connector is away from the unit, and push the connector straight on (not at an angle) when the wiring is complete.*

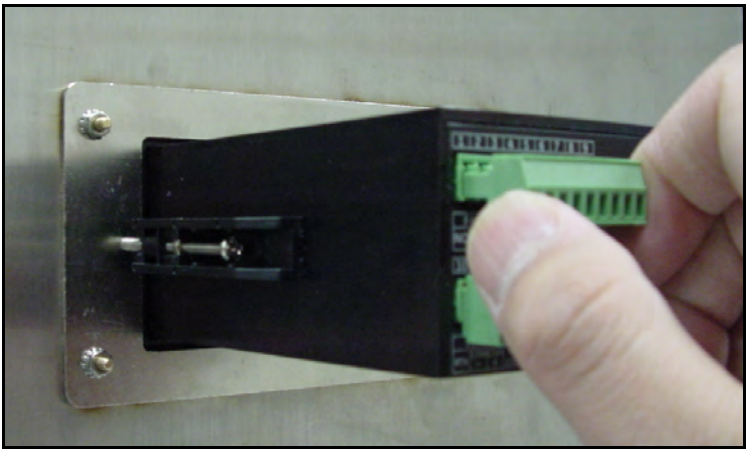

Figure 37: Removing the Upper Connector

2.6.4b Connecting the Fault Alarm

If enabled, the fault alarm trips when one or more of the following faults occurs:

- power failure
- range error (configurable)
- watchdog function system reset

Note: *The* watchdog function *is a supervisory circuit that automatically resets the unit whenever a system error occurs.*

The fault alarm may operate in *fail-safe* mode and uses *pins 2 and 3* to provide a *"normally closed"* contact. When the **MTS6** is operating in a non-fault state, the fault alarm relay is energized to open the contact between pins 2 and 3. When a fault occurs, the fault alarm relay is de-energized to close the contact between pins 2 and 3.

Note: *The contact between pins 1 (normally open) and 2 works in the opposite way. The alarm is energized to close the contact during ordinary operation and the alarm is de-energized to open the contact when there is a fault.*

IMPORTANT: *Ensure that the power is off before proceeding.*

To wire the fault alarm, make connections to the upper terminal block on the back of the **MTS6**, as shown in Figure 25 and Figure 26 on page 19.

IMPORTANT: *To maintain good contact at each terminal block and to avoid damaging the pins on the connector, pull the connector straight off (not at an angle), make cable connections while the connector is away from the unit, and push the connector straight on (not at an angle) when the wiring is complete.*

2.6.5 Installing the AC Power Cable

To install the AC power cable, included with the **MTS6**, simply plug the female connector end of the cable into the male connector on the rear panel of the **MTS6** (see Figure 25 on page 19, Figure 38 and Figure 39).

1 2 3 4 5 6 7 8 9
RELAY RATING:
30 VDC, 3A
250 VAC, 3A
NO C NC NO C NC NO C NC
100-240 VAC
50-60Hz, 5W
10 11 12 13 14 15 16 17 18
RTN COM COM + 15V – + SHD RED GRN
MEMORY CARD

Figure 38: Inserting the AC Power Cable

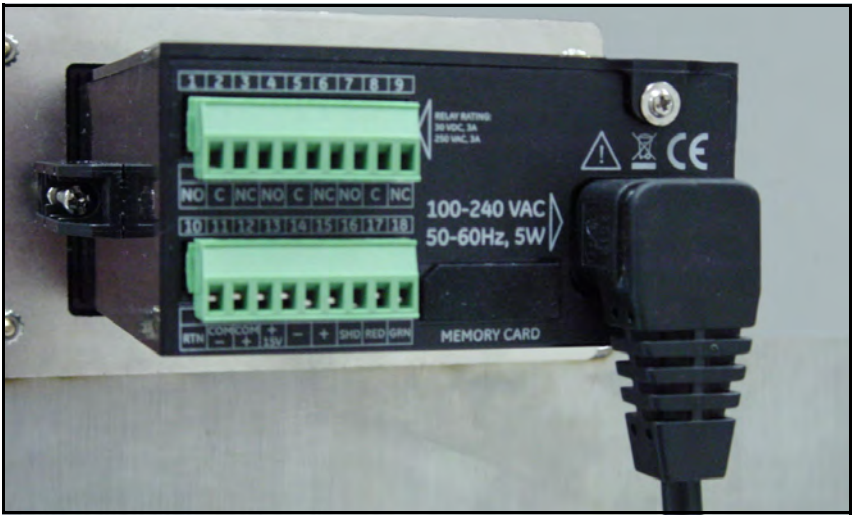

Figure 39: The AC Power Cable Installed

2.6.6 Installing the DC Power Cable

The DC power cable (with 14 to 26 AWG wires) is supplied by the customer. Use the following instructions to connect the cable to the **MTS6**.

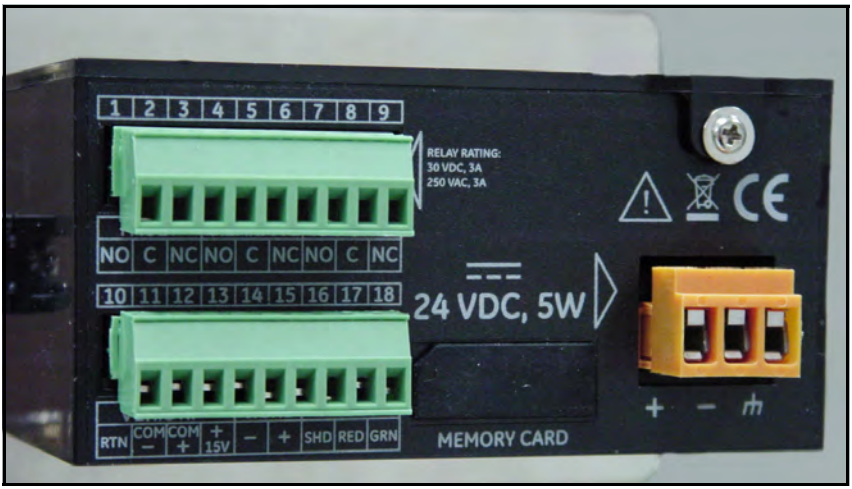
1 2 3 4 5 6 7 8 9
RELAY RATING:
30 VDC, 3A
250 VAC, 3A
NO C NC NO C NC NO C NC
10 11 12 13 14 15 16 17 18
24 VDC, 5W
RTN COM COM +15V SHD RED GRN
MEMORY CARD

Figure 40: MTS6 Rear Panel Connections - DC Version

1. Remove the DC Connector from the rear panel (see Figure 41).

Figure 41: Removing the DC Connector

2.6.6 Installing the DC Power Cable (cont.)

2. Strip each conductor of the DC power cable by approximately 3/8".

3. Insert each wire into the appropriate slot (+, – and chassis) and tighten each screw to secure them in place.

IMPORTANT: *Ensure that the chassis ground connection is properly grounded.*

4. Reinsert the DC connector into the rear panel (see Figure 42).

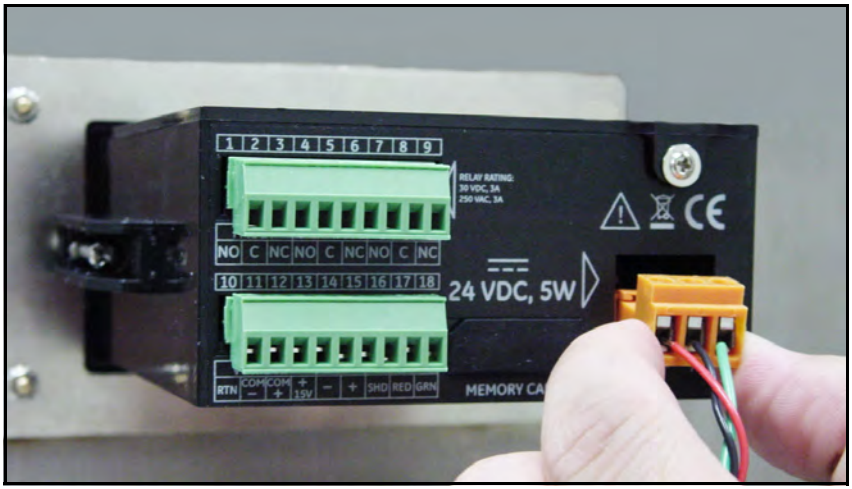

Figure 42: Reinserting the DC Connector

Chapter 3. Operation and Programming

3.1 Using the MTS6

3.1.1 Starting Up

After proper installation, the **MTS6** Transmitter can be set up to accommodate the user's requirements. Typically, the user may need to configure the analog outputs, trim the analog outputs, and program logging. Refer to a Menu Map, Figure 49 on page 94 when using an M Series probe, or Figure 50 on page 95 when using a VeriDri probe, and complete the following steps. Upon startup, the **MTS6** proceeds through several displays until a screen similar to the following appears:

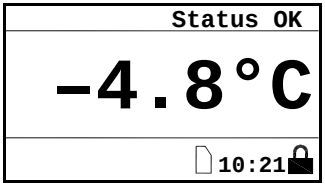

After startup, the screen will need to be unlocked. To unlock the screen, press

Note: *In most instances; use the* **Enter** *key to save an entry and/or move ahead to the following screen; use the* **Cancel** *key to reject an entry and/or return to the previous screen.*

3.1.2 Accessing the Menus

After successfully unlocking the keypad, press **Cancel** ✘. The **MTS6** will display the Main Menu (see Figure 43). Use the arrow keys to select the menu item desired. Refer to *Menu Map*, Figure 49 on page 94.

Press **Enter** ✓ to select the highlighted item. Many menu items will display another menu. Use **Cancel** ✘ to return to the previous menu page. Pressing **Cancel** ✘ from the Main Menu will return the screen to the Measurement Display.

Note: *Menu items displayed with an ellipsis (shown as a series of three dots after the menu item) will bring up more choices, while those without take immediate action.*

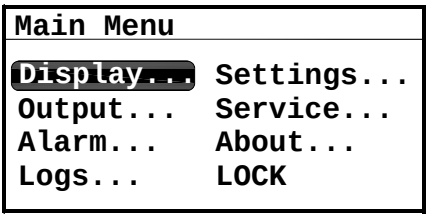

Figure 43: Main Menu

3.1.3 Entering Numeric Values

Since the **MTS6** has no numeric keypad, numeric values are entered using a "combination lock" style of entry:

Use the **left** ◀ and **right** ▶ arrow keys to select the digit to change. The digit selected will be indicated with a ▲.

Use the **up** ▲ and **down** ▼ arrow keys to increment or decrement the digit.

Note: *If incrementing or decrementing a digit would cause the numeric value to exceed its allowable range (maximum/minimum value), the digit will not change.*

Press **Enter** ✓ to save the new value and return, or **Cancel** ✗ to return, leaving the original value intact.

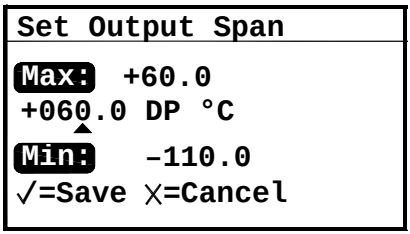

Figure 44: Numeric Entry

3.2 Setting Up the Display

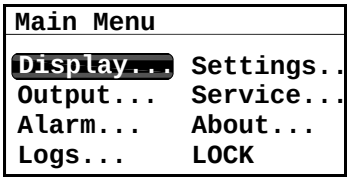

When the screen is unlocked, touch the **Cancel** ✘ key and the Main Menu appears with several options. To set up the display, select Display... and press **Enter** ✓. The following screen appears:

3.2.1 Selecting Primary Units

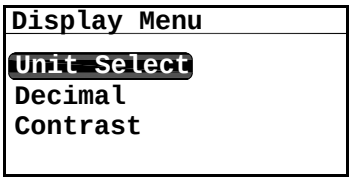

To select units for the primary display, select Unit Select and press **Enter** ✓. The following screen appears:

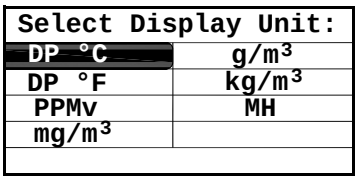

Use the arrow keys to select the desired units and press **Enter** ✓. The screen returns to the Display Menu.

Note: *If the* VeriDri *probe is being used,* FH *replaces* MH.

Note: *If the ppmv software version was purchased, PPMv, mg/m^3, g/m^3, and kg/m^3 will be available.*

3.2.2 Setting Decimal Places

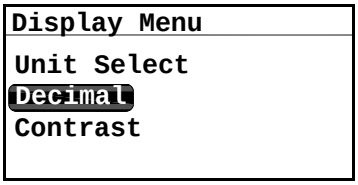

To set the decimal places for unit values, from the Display Menu use the arrow keys to select Decimal and press **Enter** ✓. The following screen appears.

The decimal places setting determines the number of digits displayed for the value to the right of the decimal symbol ("**.**"), if possible.

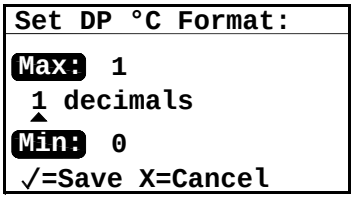

Use the arrow keys to change the number of decimal places and press **Enter** ✓, or press **Cancel** ✗ if no changes are necessary. The screen returns to the Display Menu.

3.2.3 Contrast

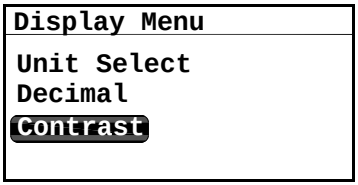

To modify the display contrast, from the Display Menu use the arrow keys to select Contrast and press **Enter** ✓. The following screen appears.

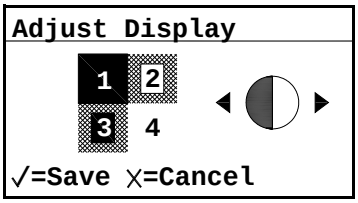

Use the Right/Left arrow keys to increase/decrease display contrast. Press **Enter** ✓ to save the changes, or press **Cancel** ✗ to return to the previous setup. The screen returns to the Display Menu.

3.3 Setting Up the Output

3.3.1 Entering the Output Menu

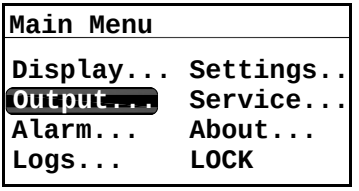

To set up the output, from the Main Menu choose Output... and press **Enter** ✓. The following screen appears.

3.3.2 Selecting Output Units

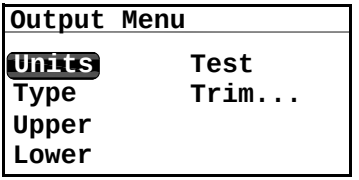

From the Output Menu, select Units and press **Enter** ✓. The following screen appears.

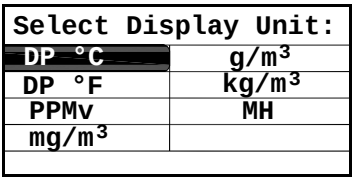

Use the arrow keys to select the unit type and press **Enter** ✓. The screen returns to the Output Menu:

Note: *If the* VeriDri *probe is being used,* FH *replaces* MH.

Note: *If the ppmv software version was purchased, PPMv, mg/m^3, g/m^3, and kg/m^3 will be available.*

3.3.3 Selecting an Output Type

Note: *Before changing the output type, refer to Section 2.2* Selecting the Recorder Output *on page 4 to make sure that Switch S1 is at the correct setting (V for voltage or I for current).*

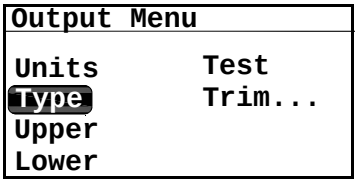

To change the output type, from the Output Menu select Type and press **Enter** ✓. A screen similar to the following appears:

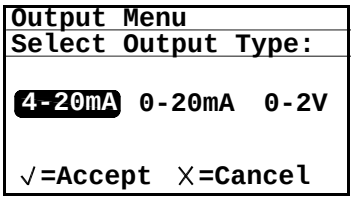

Use the arrow keys to select a new output type. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the Output Menu.

3.3.4 Changing the Upper Output Span

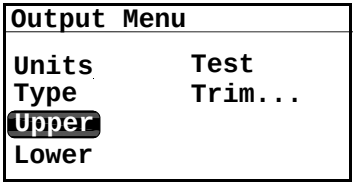

To adjust the upper output span, from the Output Menu select Upper and press **Enter** ✓. A screen similar to the following appears.

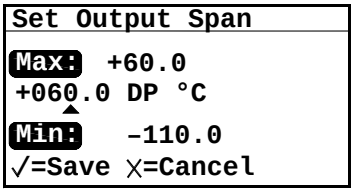

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to Output Menu.

3.3.5 Changing the Lower Output Span

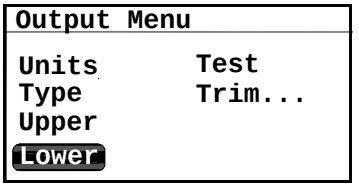

To adjust the lower output span, from the Output Menu select Lower and press **Enter** ✓. A screen similar to the following appears.

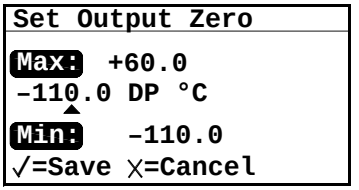

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to Output Menu.

3.3.6 Testing the Output

The Test Menu causes the **MTS6** to generate a 0- or 4-20mA output, or a 0-2V output, at the percent of scale selected. For example, in 4-20mA operation, 0% = 4mA, 50% = 12mA, 100% = 20mA. This allows the proper function of recording or SCADA equipment to be verified. In 0-20 operation, 0% = 0mA, 50% = 10mA, 100% = 20mA

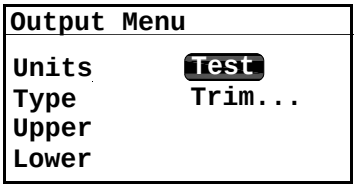

To test system output, from the Output Menu select Test and press **Enter** ✓. The **MTS6** will proceed to check the settings, and a screen similar to the following will appear.

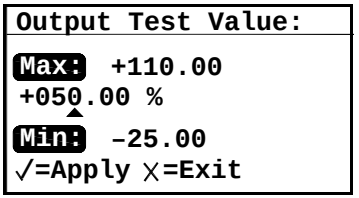

Use the left and right arrow keys to select each digit to be changed, and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the Output Menu.

Check your output wiring. If the reading on your SCADA or DCS is off slightly, then you may use the Trim feature to trim the output zero or span.

3.3.7 Trimming the Outputs

The Trim Menu enables the operator to compensate for differences in measurement of the 0/4-20 mA or 0-2V outputs by connected recorders or SCADA equipment. To trim the output:

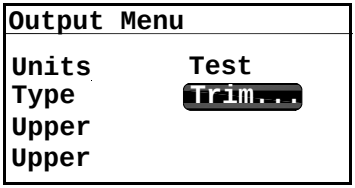

Select Trim from the Output Menu and press **Enter** ✓. The following screen appears.

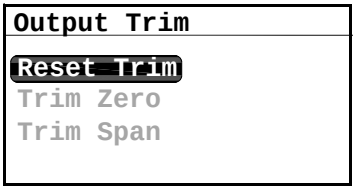

When performing a Trim operation, the **MTS6** unit requires you to first reset the trim. To reset the trim output, select Reset Trim and press **Enter** ✓. The following screen appears.

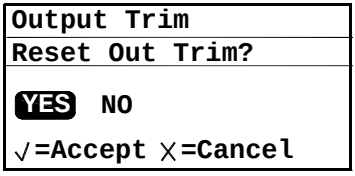

Use the left or right arrow keys to select YES and press **Enter** ✓. This cancels any previous trim values, and returns the **MTS6** to its factory adjustment. The display returns to the previous screen.

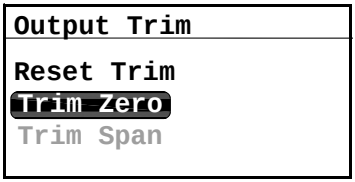

To trim the zero value, select Trim Zero and press **Enter** ✓. A screen similar to the following appears.

This will cause the **MTS6** to output 4.000 mA or 0.4 V on the output being trimmed. The output value should then be read using the connected recorder, SCADA equipment, or DVM. Enter the value read from the connected equipment as the Zero Trim value, as follows:

Note: *Since you cannot trim 0 mA or 0 V for negative offsets, trim for the lower end of the scale is at the 4 mA or 0.4 V output level.*

3.3.7 Trimming the Outputs (cont.)

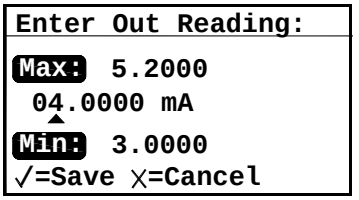

Use the left and right arrow keys to select each digit to be changed, and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value).

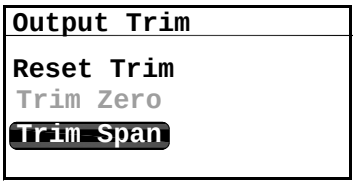

The Output Trim menu returns with Trim Span highlighted. To change the span value, press **Enter** ✓. A screen similar to the following appears.

This will cause the **MTS6** to output 20.000 mA on the output being trimmed. The output value should then be read using the connected recorder, SCADA equipment, or DVM. Enter the value read from the connected equipment as the Span Trim value.

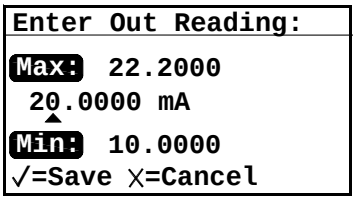

Use the left and right arrow keys to select each digit to be changed, and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value).

Trimming is complete. Accuracy can be verified using the Test Menu, above.

Example: Trim is reset, then Trim Zero is selected. The SCADA input reports 3.977 mA.
The operator enters “3.977” as the Zero Trim value.
Trim Span is selected. The SCADA input reports 19.985 mA.
The operator enters “19.985” as the Span Trim value.
MTS6 will adjust the output accordingly to true the output as read by the customer recorder, SCADA or DVM.
Using the Test Menu, the operator verifies that a test value of 0% now reads 4.000 mA at the SCADA equipment, and a test value of 100% now reads 20.000 mA.

3.4 Setting Up Alarms

Note: *The* **MTS6** *is equipped with two programmable high/low alarm relays and one fault alarm.*

3.4.1 Selecting an Alarm Output

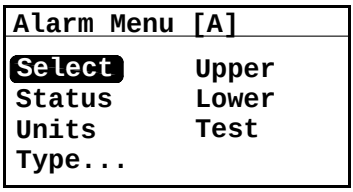

To set up alarm outputs, on the Main Menu choose Alarm and press **Enter** ✓. From the Alarm Menu choose Select and press **Enter** ✓. A screen similar to the following appears.

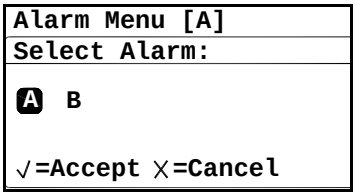

Use the arrow keys to select the output (A or B) to be set up and press **Enter** ✓. The display returns to the Alarm Menu.

3.4.2 Selecting Alarm Status

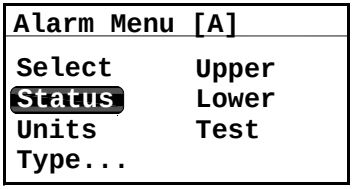

To select the alarm status, from the Alarm Menu select Status and press **Enter** ✓. The following screen appears:

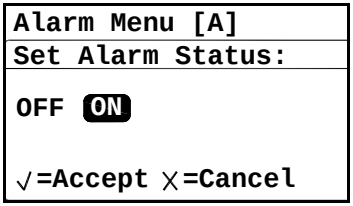

Use the arrow keys to select OFF or ON and press **Enter** ✓. The display returns to the Alarm Menu.

3.4.3 Selecting Alarm Units

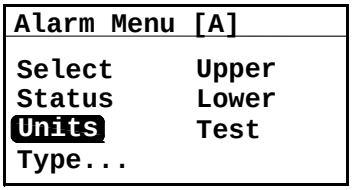

To select alarm units, from the Alarm Menu select Units and press **Enter** ✓.

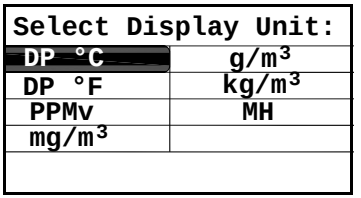

Use the arrow keys to select a unit. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the Alarm Menu.

Note: *If the VeriDri probe is being used,* FH *replaces* MH.

Note: *If the ppmv software version was purchased, PPMv, mg/m^3, g/m^3, and kg/m^3 will be available.*

3.4.4 Selecting an Alarm Type

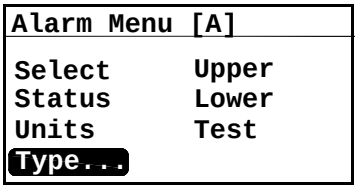

To change the alarm type, from the Alarm Menu select Type and press **Enter** ✓. A screen similar to the following appears:

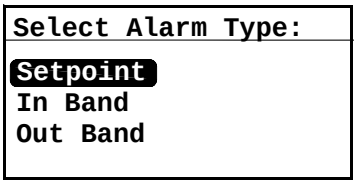

Use the arrow keys to select an alarm type. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the Alarm Menu.

3.4.4 Selecting an Alarm Type (cont.)

- SetPoint: Alarm activates when parameter exceeds upper limit, and deactivates when parameter is less than lower limit.
- Inner Band: Alarm activates when parameter is between upper and lower limits.
- Outer Band: Alarm activates when parameter is outside upper and lower limits.

3.4.5 How the Alarm Types Work

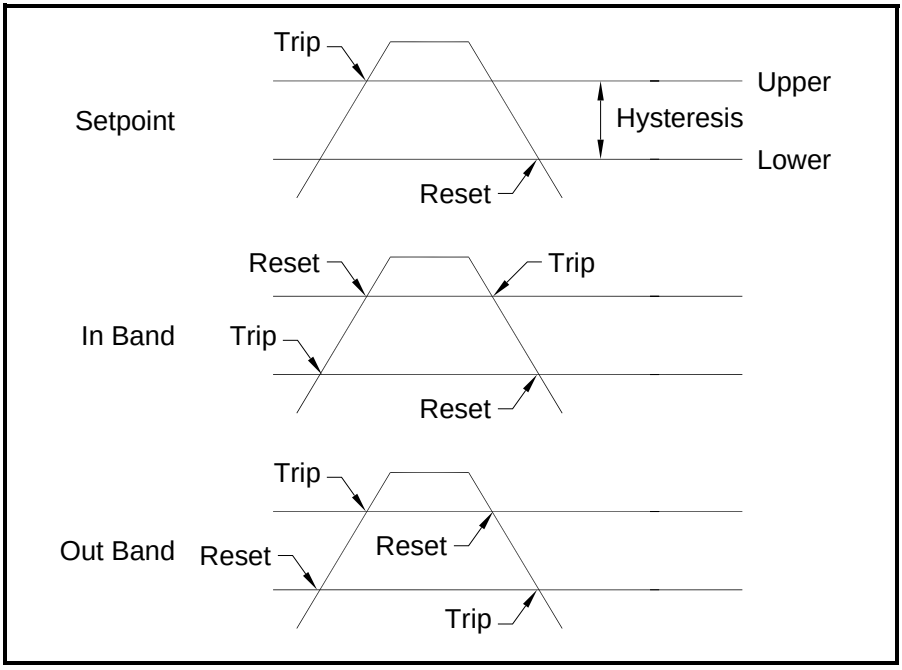

Figure 45: Example of Alarm Types

3.4.6 Changing the Upper Alarm Span

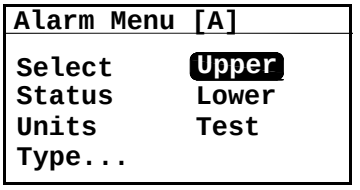

To adjust the upper alarm span, from the Alarm Menu select Upper and press **Enter** ✓. A screen similar to the following appears.

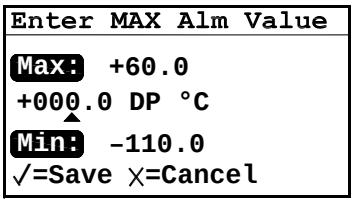

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the Alarm Menu.

3.4.7 Changing the Lower Alarm Span

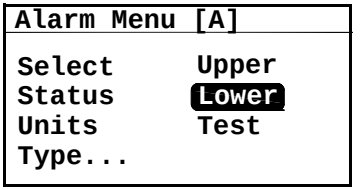

To adjust the lower alarm span, from the Alarm Menu select Lower and press **Enter** ✓. A screen similar to the following appears.

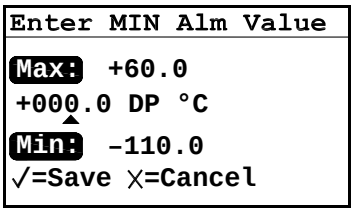

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the Alarm Menu.

3.4.8 Testing the Alarm Relays

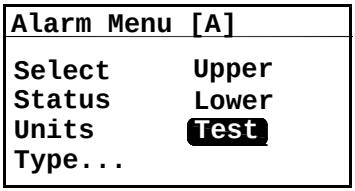

To test the alarm relay, and devices connected to it, from the Alarm Menu select Test and press **Enter** ✓. A screen similar to the following appears.

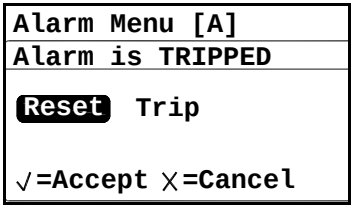

Use the left and right arrow keys to select Reset or Trip and press **Enter** ✓. If Reset was selected, the message Alarm is RESET appears. If Trip was selected, the message Alarm is Tripped appears. Press **Cancel** ✘ to return to the Alarm Menu.

3.5 Logging

3.5.1 Checking the Data Log Status

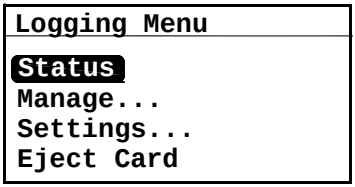

To check the data log status, from the Logging Menu select Status and press **Enter** ✓. A screen similar to the following appears.

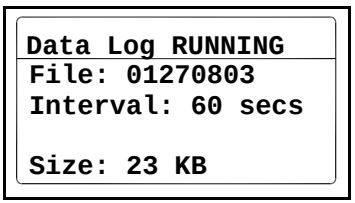

The current data log status is displayed. After about 10 seconds, the screen returns to the Logging Menu.

3.5.2 Log Settings Menu

Note: *To access the* Settings... *option under the* Logging Menu, *the log file must be stopped (see* Starting/Stopping Log Files *on page 51.*

3.5.2a Setting Log Units

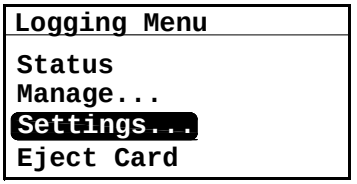

From the Logging Menu select Settings... and press **Enter** ✓. The following screen appears.

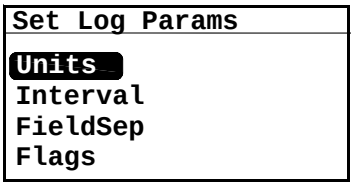

To set units to log, from the Set Log Params menu, select Units and press **Enter** ✓. The following screen appears.

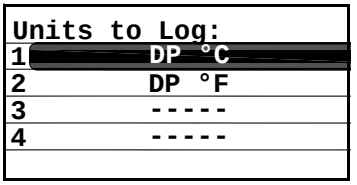

Use the arrow keys to select the unit to log, and press **Enter** ✓. The following screen appears.

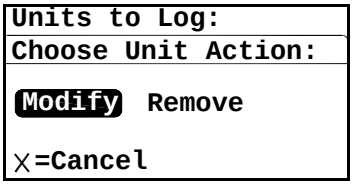

To change the unit setting, select Modify and press **Enter** ✓. The following screen appears.

3.5.2a Setting Log Units (cont.)

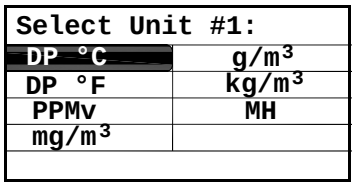

Use the arrow keys to select the unit to be represented by #1 and press **Enter** ✓. The screen returns to the Units to Log menu.

Note: *If the VeriDri probe is being used,* FH *replaces* MH.

Note: *If the ppmv software version was purchased, PPMv, mg/m^3, g/m^3, and kg/m^3 will be available.*

To remove a unit, from the Units to Log menu, select Remove and press **Enter** ✓. Select the unit to be removed, press **Enter** ✓, and the unit is deleted. Press **Cancel** ✗ to return to the Set Log Params menu.

3.5.2b Setting the Log Interval

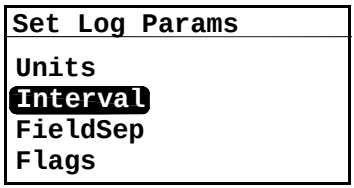

To set the log interval, from the Set Log Params menu, select Interval and press **Enter** ✓. The following screen appears.

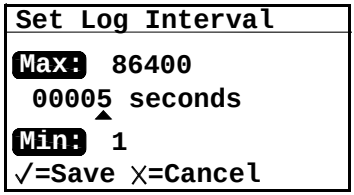

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the Set Log Params menu.

3.5.2c Setting a Field Separator

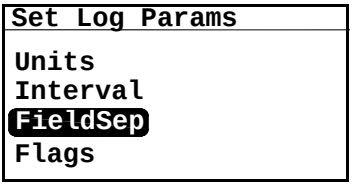

To designate a mark to separate the log fields, from the Set Log Params menu select FieldSep and press **Enter** ✓. The following screen appears.

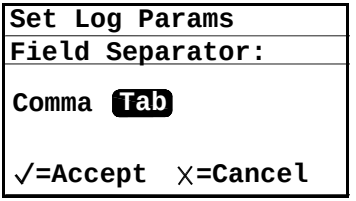

Use the arrow keys to select the mark used to separate the log fields and press **Enter** ✓. The screen returns to the Set Log Params menu.

3.5.2d Setting Log Status Flags

Note: *The flags used to identify the log status are as follows:*

Range Err	**No Comm**	**Bad Message**	**No Data**	**Read Err**
Over Range	**No Link**	**Auto Cal**	**No Cal**	**ADC Failure**
Under Range	**Bad CRC**	**No Refs**	**Write Err**	**Cal Error**

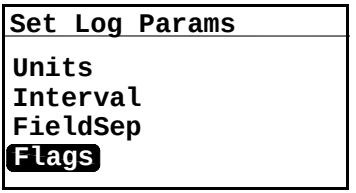

To turn log status flags on or off, from the Set Log Params menu select Flags and press **Enter** ✓. The following screen appears.

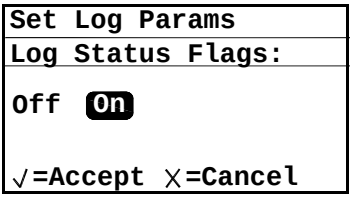

Use the arrow keys to select OFF or ON and press **Enter** ✓. The screen returns to the Set Log Params menu.

Press **Cancel** ✗ to return to the Logging Menu.

3.5.3 Managing Log Files

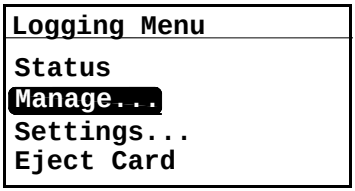

To manage the log file status, from the Logging Menu select Manage and press **Enter** ✓. If no log has been created, the following screen appears.

3.5.3a Creating a New Log

Note: *In order for the new log option to be available, there can be no log running or paused. If there is any previous log running/paused, it will need to be closed. Once closed, the closed log file cannot be resumed.*

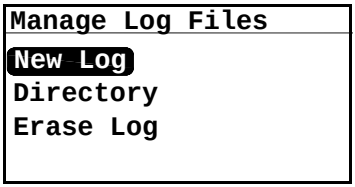

To create a new log, from the Manage Log Files menu select New Log and press **Enter** ✓. A screen similar to the following appears.

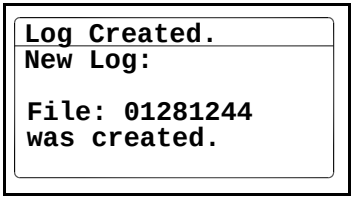

A file name is assigned by the **MTS6** to the new log. This name corresponds to the date and time the log is started. A log started on May 1 at 4:37 pm will be named 05011637. After about 10 seconds, the screen returns to the Manage Log Files menu.

Note: *When a new log is created, the* Manage Log Files *menu changes to the following screen.*

3.5.3b Pausing a Log

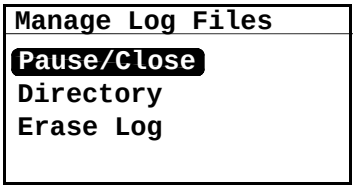

When a new log is created, it can be paused or closed. To pause the log, from the Manage Log Files menu select Pause/Close and press **Enter** ✓. The following screen appears.

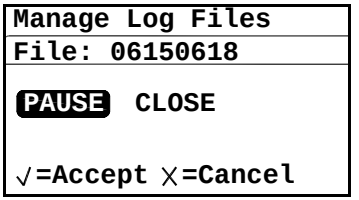

Select Pause and press **Enter** ✓. the screen returns to the Manage Log Files menu.

Note: *When a log is paused, the* Manage Log Files *menu changes to the following screen.*

3.5.3c Resuming a Log

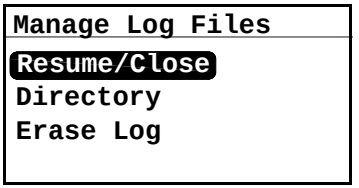

A paused log can be resumed or closed. To resume the log function, from the Manage Log Files menu select Resume/Close and press **Enter** ✓. The following screen appears.

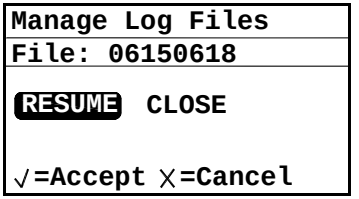

Select Resume and press **Enter** ✓. the screen returns to the Manage Log Files menu.

Note: *When a log is resumed, the* Manage Log Files *menu displays the Pause/Close option again.*

Note: *If a log is running and it reboots due to a power failure, it will always return to the previous state prior to the power failure. If it was running, it will continue to run. If it was paused, it will stay paused and can be resumed.*

3.5.3d Viewing the Log Directory

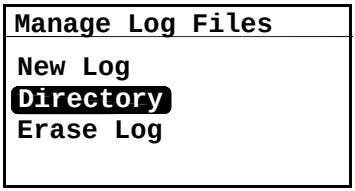

To view the existing log names, select Directory and press **Enter** ✓. A screen similar to the following appears.

When a listing is highlighted, the date, time and size of each log appears at the bottom of the screen. Use the arrow keys to move from one listing to another. To return to the Manage Log Files menu, press **Cancel** ✘.

3.5.3e Deleting Log Files

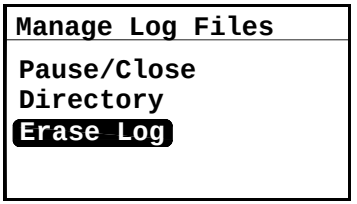

To erase an existing log file(s), from the Manage Log Files menu, select Erase Log and press **Enter** ✓. The File Listing screen appears.

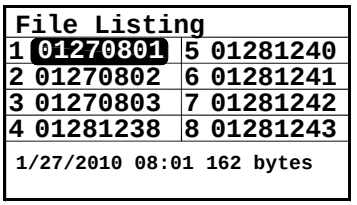

Using the arrow keys, move to the listing to be deleted, and press **Enter** ✓. The following screen appears.

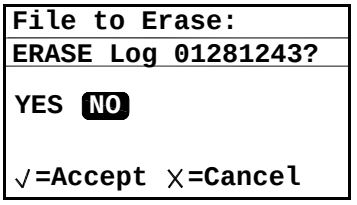

Using the arrow keys, select YES to erase the listing, or NO to save the listing. Press **Enter** ✓ and the screen returns to File Listing. If YES was selected, the particular number is gone. If NO was selected, the number is still present.

Press the **Cancel** ✘ key to return to the Manage Log Files menu.

3.5.4 Ejecting the SD Card

Removing the MicroSD card requires two steps. First, the active files must be closed. This step is referred to as ejecting the SD Card. The MicroSD card can now be removed from the **MTS6**.

Note: *Physically removing the MicroSD card from the* **MTS6** *without performing the eject routine below may result in data loss. This will not result in damage to either the MicroSD card or to the* **MTS6**.

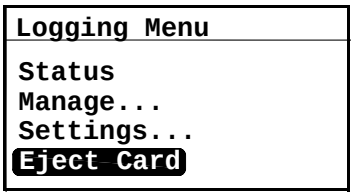

To eject the SD card, from the Logging Menu, select Eject Card and press **Enter** ✓. The following screen appears.

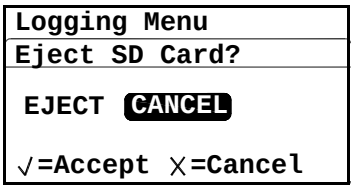

Use the arrow keys to select EJECT or CANCEL and press **Enter** ✓. The screen returns to the Logging Menu.

Press **Cancel** ✗ to return to the Main Menu.

Note: *If* EJECT *was selected, the MicroSD card may now be removed from the* **MTS6**. *To remove and read the card see* Reading the MicroSD Card *on page 97.*

3.5.5 Viewing Data Logs

Any MicroSD card reader may be used to read the MicroSD card. The log file is in text format, therefore, any word processing or spreadsheet program may be used to read the data.

Refer to Appendix C for examples on how to work with log files.

3.6 Setting Other Information

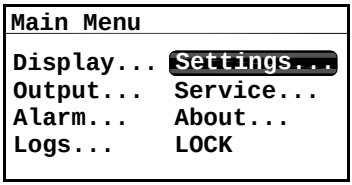

To change other settings, from the Main Menu select Settings... and press **Enter** ✓. The following screen appears.

3.6.1 Entering the Passcode

The Settings Menu is the only menu that requires a passcode. The passcode is a four-digit number that enables only authorized users to enter setup data. The MTS6 prompts you to enter the passcode when you enter the Settings Menu. See page 79 for your default passcode.

3.6.2 Setting the Fault Alarm

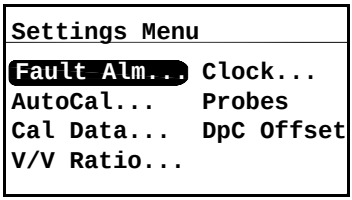

To configure the fault alarm, from the Settings Menu select Fault Alarm and press **Enter** ✓. The following screen appears.

Note: *To access the* Fault Alarm *menu, the* User Passcode *is required (see section 3.6.1 above).*

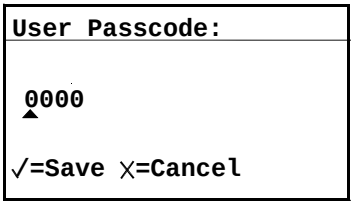

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the passcode has been entered, press **Enter** ✓ and the following screen appears.

3.6.2a Setting Fault Alarm Status

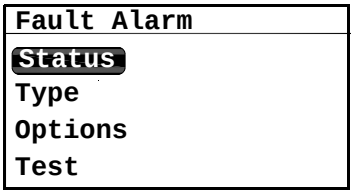

To check the status of the fault alarm, from the Fault Alarm menu, select Status and press **Enter** ✓. The following screen appears.

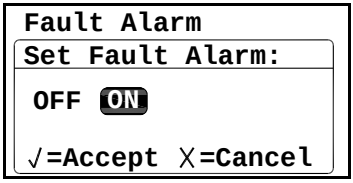

To change the status of the fault alarm, select OFF or ON and press **Enter** ✓. The screen returns to the Fault Alarm menu.

3.6.2b Setting the Fault Relay Type

Note: *For more information on the meaning of relay types, see section 2.6.4b Connecting the Fault Alarm on page 29.*

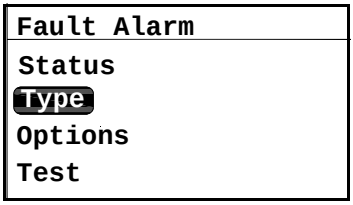

To check and/or change the fault relay type, select Type and press **Enter** ✓. The following screen appears.

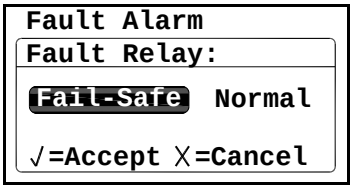

To change the type of fault relay, select the other option and press **Enter** ✓. The screen returns to the Fault Alarm menu.

3.6.2c Setting Fault Alarm Options

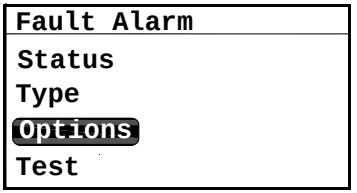

To view the status other options select Options and press **Enter** ✓. The following screen appears.

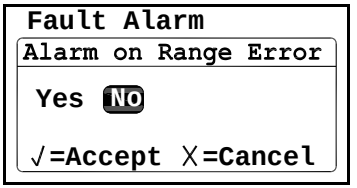

To change the status of the range error alarm, select Yes or No and press **Enter** ✓. The screen returns to the Fault Alarm menu. Press **Cancel** ✗ to return to the Settings Menu.

3.6.2d Testing the Fault Alarm

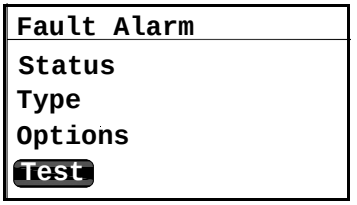

To test the fault alarm, select Test and press **Enter** ✓. The following screen appears.

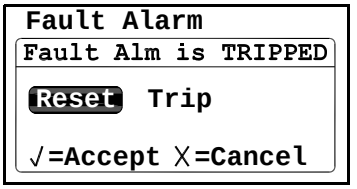

To reset the fault alarm, select Reset and press **Enter** ✓. To trip the fault alarm, select Trip and press **Enter** ✓. Press **Cancel** ✗ twice to return to the Settings Menu.

3.6.3 Setting Autocal

Note: *To enter the* Autocal Settings *menu, you must be using a standard* M Series *probe. If a* VeriDri *probe is being used,* AutoCal *is not necessary and will not be accessible.*

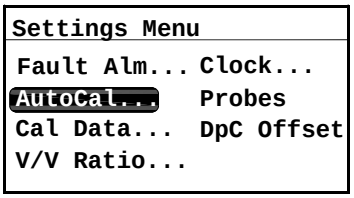

To change the Autocal settings, from the Settings Menu select AutoCal and press **Enter** ✓. The following screen appears.

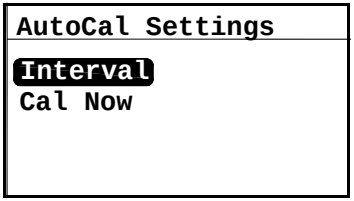

To change the Autocal interval settings, select Interval and press **Enter** ✓. A screen similar to the following appears.

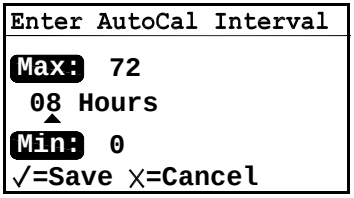

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the AutoCal Settings menu.

To accept or reject AutoCal, select Cal Now and press **Enter** ✓. A screen similar to the following appears.

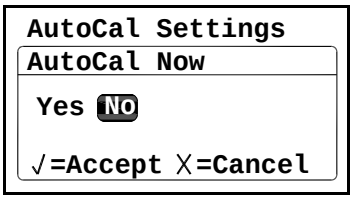

To accept AutoCal, select Yes. To reject AutoCal select No. Press **Enter** ✓ to confirm your selection and return to the AutoCal Settings menu.

3.6.4 Setting Calibration Data 1

Note: *If you are using a standard* M Series *probe, the following steps will apply. If you are using a* VeriDri *probe, see* Setting Calibration Data 2 *on page 63.*

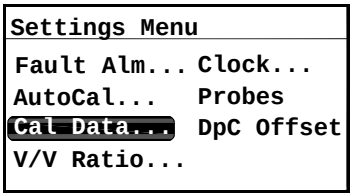

Note: *To update calibration data, from the Settings Menu select Cal Data and press* ***Enter*** ✓*. The following screen appears.*

Note: *To access the Cal Data menu, the User Passcode is required (see section 3.6.1 on page 56).*

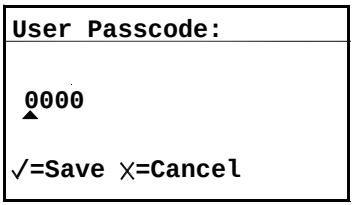

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the passcode has been entered, press **Enter** ✓ and the following screen appears.

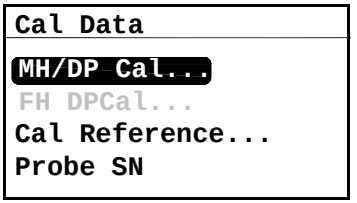

If you are using a standard M Series probe, the MH/DP Cal will be highlighted. Press **Enter** ✓. The following screen appears.

3.6.4a Selecting the Number of Points

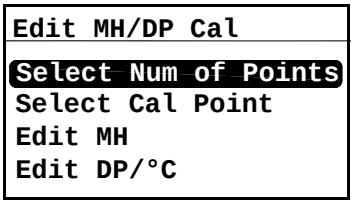

To select the number of points, highlight Select Num of Points and press **Enter** ✓. The following screen appears.

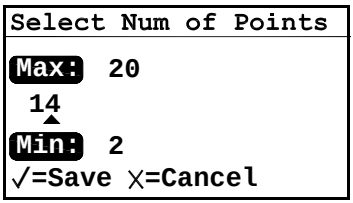

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the Edit MH/DP Cal menu.

3.6.4b Selecting the Calibration Point

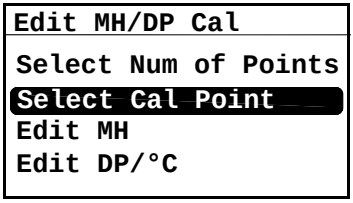

To select the calibration point, highlight Select Cal Point and press **Enter** ✓. The following screen appears.

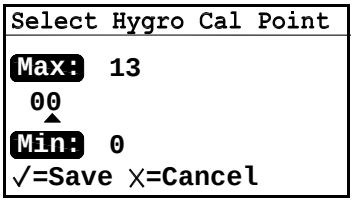

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the Edit MH/DP Cal menu.

3.6.4c Setting the MH Calibration

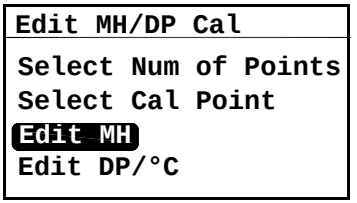

To set up the MH calibration, highlight Edit MH and press **Enter** ✓. The following screen appears.

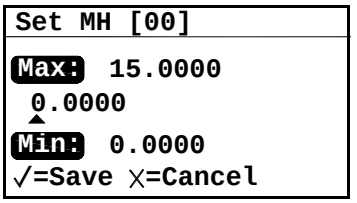

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the Edit MH/DP Cal menu.

3.6.4d Setting the Dew Point Calibration

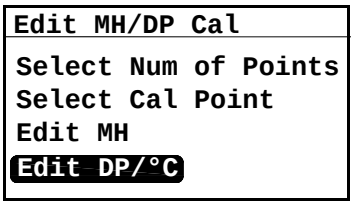

To set up the dew point calibration, highlight Edit DP/°C and press **Enter** ✓. The following screen appears.

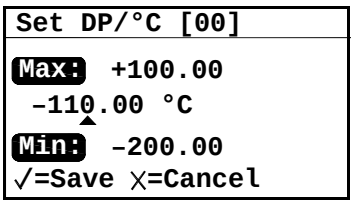

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the Edit MH/DP Cal menu.

Press **Cancel** ✘ to return to the Cal Data menu.

3.6.5 Setting Calibration Data 2

Note: *If you are using a* VeriDri *probe, the following steps will apply. For a standard* M Series *probe, see* Setting Calibration Data 1 *on page 60.*

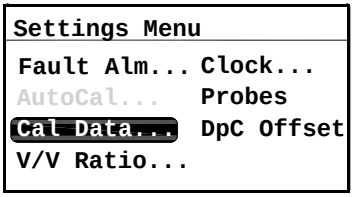

To view calibration data, from the Settings Menu select Cal Data and press **Enter** ✓. The following screen appears.

Note: *To access the Cal Data menu, the User Passcode is required (see section 3.6.1 on page 56).*

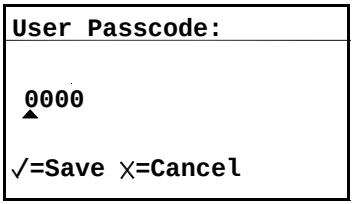

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the passcode has been entered, press **Enter** ✓ and the following screen appears.

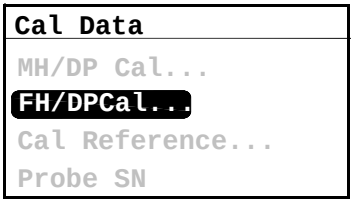

If you are using a VeriDri probe, the FH/DPCal will be highlighted. Press **Enter** ✓. The following screen appears.

3.6.5a Selecting the Calibration Point

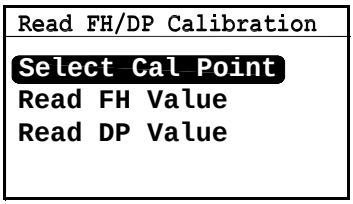

To select the calibration point, highlight Select Cal Point and press **Enter** ✓. The following screen appears.

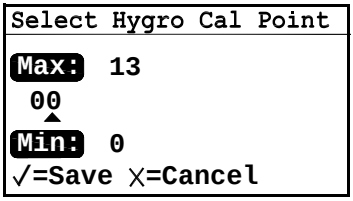

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the Edit MH/DP Cal menu.

3.6.5b *Reading the FH Value*

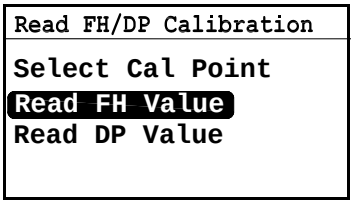

To view the FH value, highlight Read FH Value and press **Enter** ✓. The following screen appears.

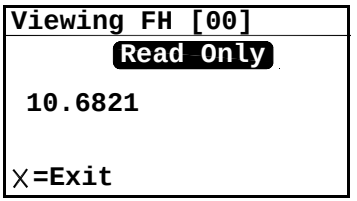

The FH value is for viewing only. When you are ready, press **Cancel** ✗ to return to the Read FH/DP Calibration menu.

3.6.5c *Reading the DP Value*

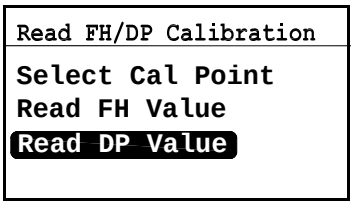

To view the DP value, highlight Read DP Value and press **Enter** ✓. The following screen appears.

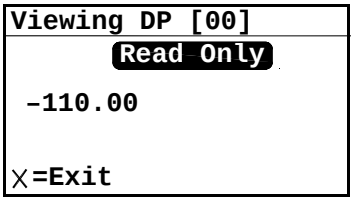

The DP value is for viewing only. When you are ready, press **Cancel** ✗ to return to the Read FH/DP Calibration menu.

Press **Cancel** ✗ twice to return to the Settings Menu.

3.6.6 Reading and Setting the Calibration References

Note: *The following procedure applies only if an* M Series *probe is being used. If a* VeriDri *probe is used,* Cal Reference... *is not accessible.*

IMPORTANT: *The* ***MTS6*** *is factory programmed with high and low reference MH values. These values are generated from a factory lab calibration and should not be changed without first consulting GE technical support. Changes to these values will alter the accuracy of the unit measurements.*

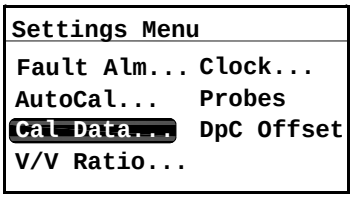

To update calibration data, from the Settings Menu select Cal Data and press **Enter** ✓. The following screen appears.

Note: *To access the Cal Data menu, the User Passcode is required (see section 3.6.1 on page 56).*

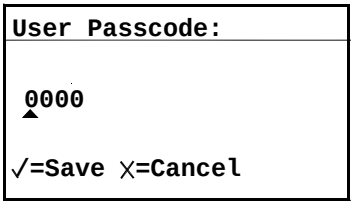

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the passcode has been entered, press **Enter** ✓ a screen similar to the following appears.

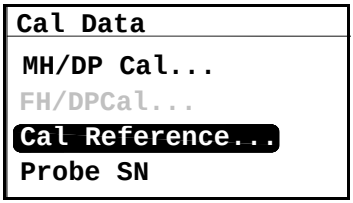

To view and/or edit the calibration reference settings, select Cal Reference and press **Enter** ✓. The following screen appears.

3.6.6a Setting the Calibration High Reference

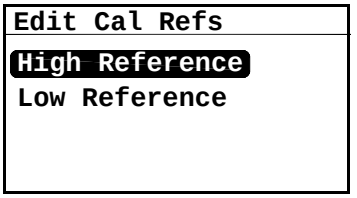

To update high reference settings, from the Edit Cal Refs menu select High Reference and press **Enter** ✓. A screen similar to the following appears.

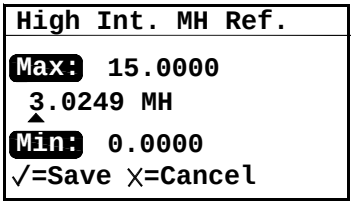

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the changes have been made, press **Enter** ✓. The screen returns to the Edit Cal Refs menu.

3.6.6b Setting the Calibration Low Reference

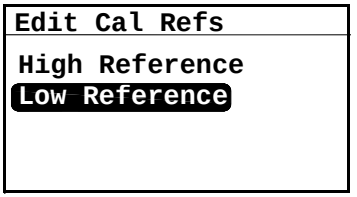

To update low reference settings, from the Edit Cal Refs menu select Low Reference and press **Enter** ✓. A screen similar to the following appears.

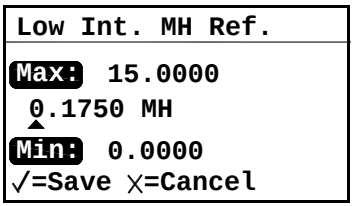

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the changes have been made, press **Enter** ✓. The screen returns to the Edit Cal Refs menu.

3.6.7 Entering the M Series Probe Serial Number

Note: *The following procedure applies only if an* M Series *probe is being used. If a* VeriDri *probe is used,* Probe SN *is not accessible.*

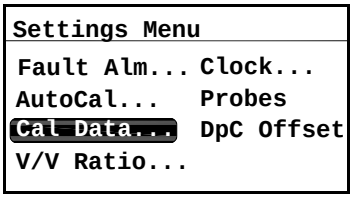

To update the probe serial number, from the Settings Menu select Cal Data and press **Enter** ✓. The following screen appears.

Note: *To access the Cal Data menu, the User Passcode is required (see section 3.6.1 on page 56).*

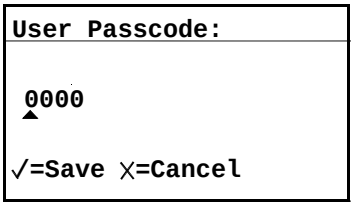

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the passcode has been entered, press **Enter** ✓ a screen similar to the following appears.

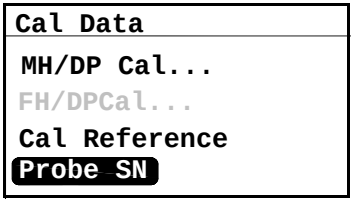

To view and/or edit the probe serial number, select Probe SN and press **Enter** ✓. The following screen appears.

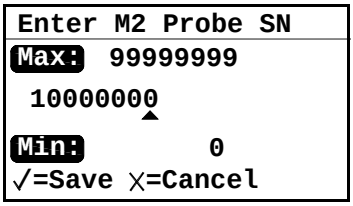

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the changes have been made, press **Enter** ✓. The screen returns to the Cal Data menu.

3.6.8 Setting the Volume Mixing Ratio

Note: *Setting the* Volume Mixing Ratio *is an optional feature, available only if the ppmv software version was purchased.*

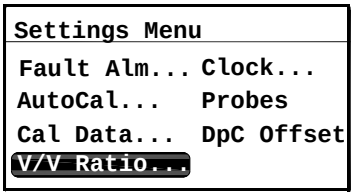

Note: *To set the volume mixing ratio, from the Settings Menu select V/V Ratio and press* **Enter** ✓. *The following screen appears.*

Note: *To access the Cal Data menu, the User Passcode is required (see section 3.6.1 on page 56).*

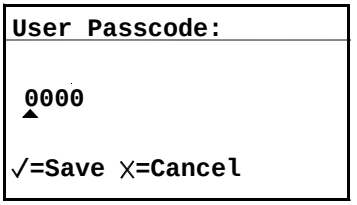

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the passcode has been entered, press **Enter** ✓ and the following screen appears.

3.6.8a Setting the Pressure Units

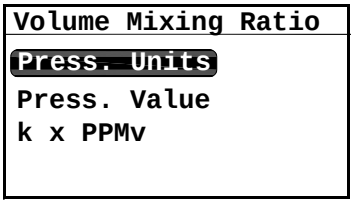

To set the pressure units, select Press. Units and press **Enter** ✓. The following screen appears.

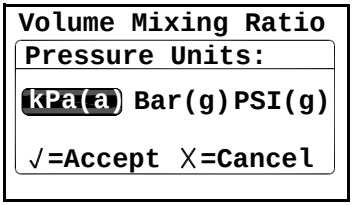

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the previous menu.

3.6.8b Setting the Pressure Value

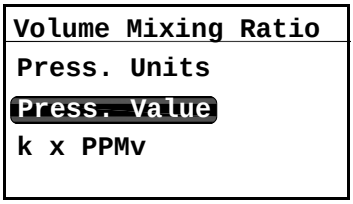

To set the pressure value, select Press. Value and press **Enter** ✓. The following screen appears.

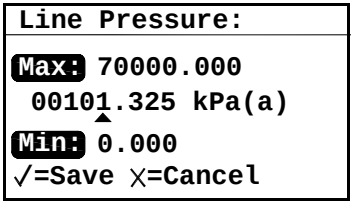

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the previous menu.

3.6.8c Setting the k x PPMv Multiplier

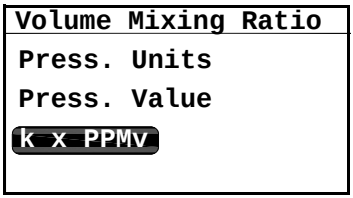

To set the k x PPMv multiplier, select k x PPMv and press **Enter** ✓. The following screen appears.

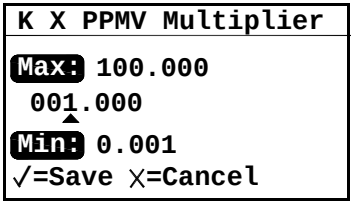

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the previous menu.

3.6.9 Resetting the Time

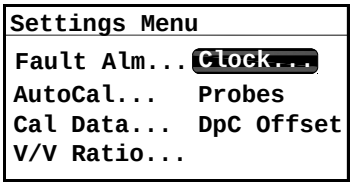

To reset the time, from the Settings Menu select Clock and press **Enter** ✓. The current time appears on the following screen.

3.6.9a Setting the Hour

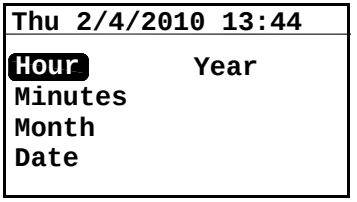

To change the hour, select Hour and press **Enter** ✓. The following screen appears.

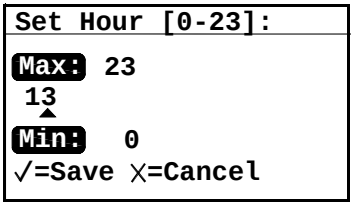

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the previous menu.

3.6.9b Setting the Minutes

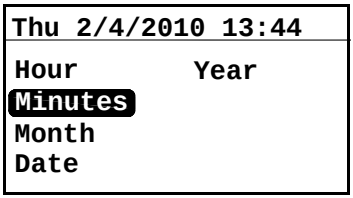

To change the minutes, select Minutes and press **Enter** ✓. The following screen appears.

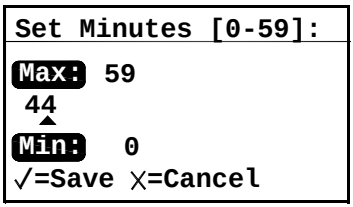

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the previous menu.

3.6.9c Setting the Month

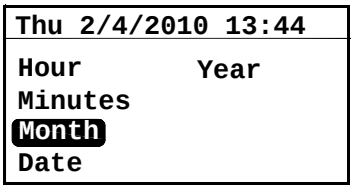

To change the month, select Month and press **Enter** ✓. The following screen appears.

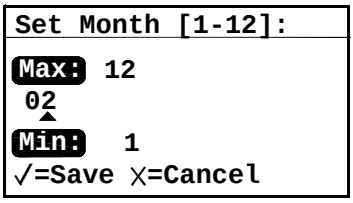

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the previous menu.

3.6.9d Setting the Date

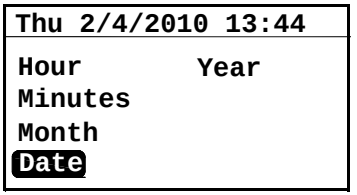

To change the date, select Date and press **Enter** ✓. The following screen appears.

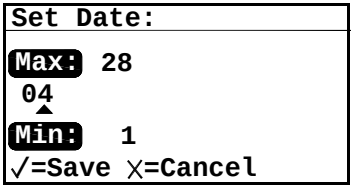

Use left and right arrow keys to select the digit to be changed. Use up and down arrow keys to change the value. Press **Enter** ✓ to save (or **Cancel** ✗ to keep the previous value), and return to the previous menu.

3.6.9e Setting the Year

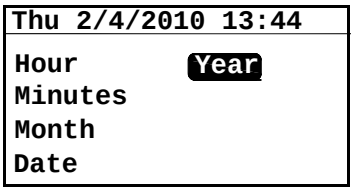

To reset the year, select Year and press **Enter** ✓. The following screen appears.

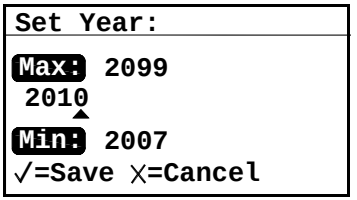

Use the left and right arrow keys to select each digit to be changed. Use the up and down arrow keys to change the value. When finished, press **Enter** ✓ and return to the previous menu, then press **Cancel** ✗ to return to the Settings Menu.

Note: *The* Service *menu is accessible only to service engineers and requires the use of a Factory-Level passcode.*

3.6.10 Selecting the Probe Type

Note: *Use the following procedure to select the probe type.*

IMPORTANT: *Changing the probe setting will default the output and alarm settings to DPC. Also, the default fault trip point values will be set along with the default output range values.*

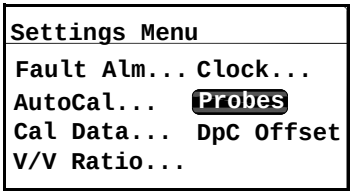

From the Settings Menu select Probes and press **Enter** ✓. The following screen appears.

Note: *To access the Probes menu, the User Passcode is required (see section 3.6.1 on page 56).*

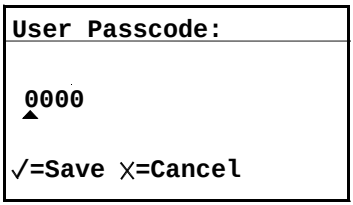

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Once the passcode has been entered, press **Enter** ✓ and the following screen appears.

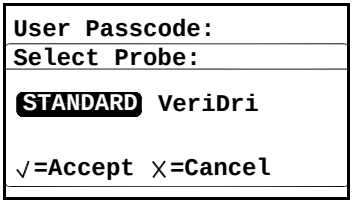

Use the left or right arrow key to select the correct probe type and press **Enter** ✓. The **MTS6** reboots in 5 seconds.

3.6.11 Setting a Constant DP °C Offset

This feature enables the customer to add a constant DP °C offset to their reading. It allows for positive or negative offset limiting to +/- 50°C. It works only within the calibrated range of the sensor. Alarms A & B are based on the offset value, and likewise, they will work only within the calibrated range of the sensor.

Note: *Use the following procedure to set the DP °C Offset.*

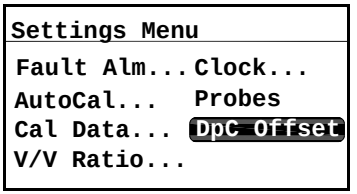

From the Settings Menu select DpC Offset and press **Enter** ✓. The following screen appears.

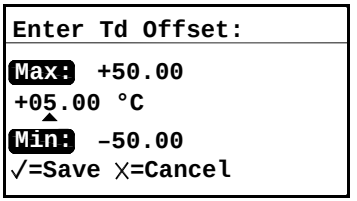

Use the left and right arrow keys to select each digit to be changed and the up and down arrow keys to increase or decrease its value. Press **Enter** ✓ to save (or **Cancel** ✘ to keep the previous value), and return to the previous menu.

3.7 Viewing System Information

3.7.1 Checking the ID

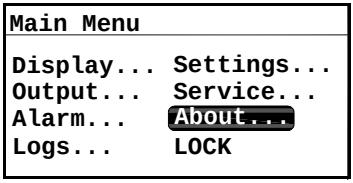

To check identification information, from the Main Menu, select About and press **Enter** ✓. The following screen appears.

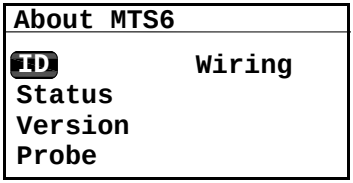

To check the identity information, select ID and press **Enter** ✓. A screen similar to the following appears.

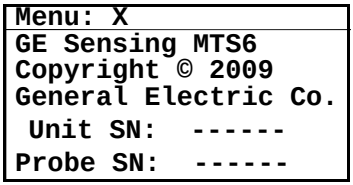

The information includes serial numbers for the **MTS6** unit and the probe. To return to the About MTS6 menu, press **Cancel** ✗.

3.7.2 Checking the Status

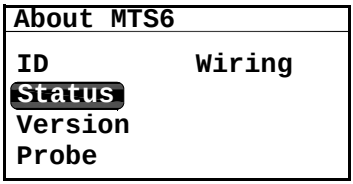

To check the status of the **MTS6**, from the About menu select Status and press **Enter** ✓. A screen similar to the following appears.

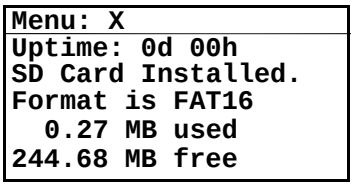

The information includes the amount of space being used and that which is free. To return to the About MTS6 menu, press **Cancel** ✗.

3.7.3 Checking the Software Version

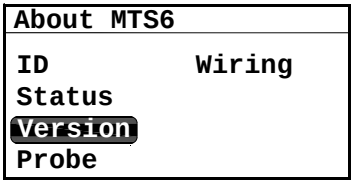

To check the software version, from the About menu select Version and press **Enter** ✓. A screen similar to the following appears.

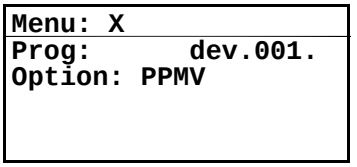

The information includes the program number and any options. To return to the About MTS6 menu, press **Cancel** ✗.

3.7.4 Checking the Probe

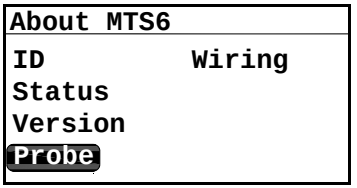

To check the probe details, from the About menu select Probe and press **Enter** ✓. A screen similar to one of the following appears.

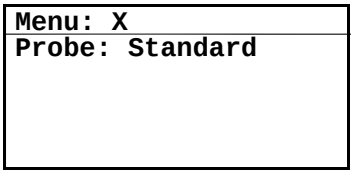

Data when using an M Series probe. To return to the About MTS6 menu, press **Cancel** ✗.

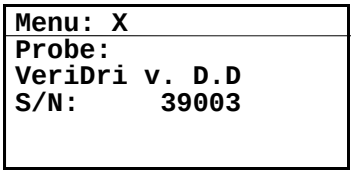

Data when using a VeriDri probe. To return to the About MTS6 menu, press **Cancel** ✗.

3.7.5 Checking the Wiring

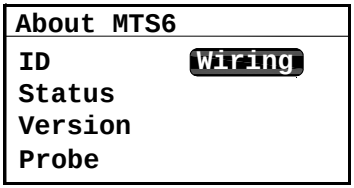

To view the **MTS6** wiring diagram, from the About menu select Wiring and press **Enter** ✓. A screen similar to the following appears.

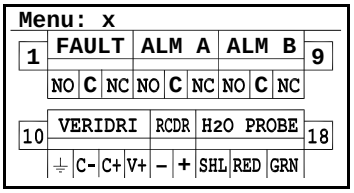

To return to the Main Menu, press **Cancel** ✘ twice.

3.8 Locking the Menu

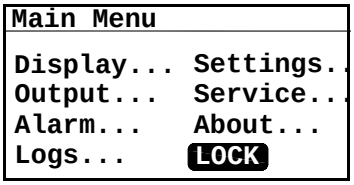

To lock the ability to make changes to the menu, select LOCK and press **Enter** ✓. The screen returns to the normal reading.

Note: *To unlock the menu, refer to* Starting Up *on page 36.*

[no content intended for this page]

Your passcode is 2719.

Please remove this page and put it in a safe place for future reference.

Chapter 4. Service and Maintenance

4.1 Introduction

The **MTS 6** is designed to be maintenance and trouble free. However, because of severe process conditions and other factors, minor problems may occur from time to time. Some of the most common problems and recommended maintenance procedures are discussed in this chapter. If you cannot find the information you need in this chapter, please consult GE for help.

CAUTION! Do not attempt to troubleshoot the MTS 6 beyond the instructions in this chapter. If you do, you may damage the unit and void the warranty.

This chapter covers the following topics:

- common problems
- replacing/recalibrating moisture probes
- cleaning the front panel

Proceed to the appropriate section to perform any of the above tasks.

4.2 Common Problems

If the **MTS 6** measurements read too wet or too dry, or if they do not make sense, there may be a problem with either the probe or a process component. Use the descriptions of common problems in Table 3 on page 82 to troubleshoot and solve such problems.

Table 3: Troubleshooting Guide for Common Problems

Possible Cause	Response and Action
Symptom: The accuracy of the moisture sensor is questioned.	
There is insufficient time for the system to equilibrate.	**Response:** Reads too wet during dry down conditions or too dry in wet up conditions. **Action:** Change the flow rate. A change in dew point indicates the sample system is not at equilibrium or there is a leak. Allow sufficient time for sample system to equilibrate and moisture reading to become steady. Check for leaks.
Dew point at the sampling point is different from the dew point of the main stream.	**Response:** Reads too wet or too dry. **Action:** Readings may be correct if the sampling point and main stream do not run under the same process conditions. The different process conditions cause readings to vary. If sampling point and main stream conditions are the same, check sample system pipes, and any pipe between the sample system and main stream for leaks. Also, check sample system for adsorbing water surfaces, such as rubber or plastic tubing, paper-type filters, or condensed water traps. Remove or replace the contaminating parts with stainless steel parts.
Sensor or sensor shield is affected by process contaminants	**Response:** Reads too wet or too dry **Action:** Clean the sensor and the sensor shield, then reinstall the sensor.
Sensor is contaminated with conductive particles.	**Response:** Reads high dew point. **Action:** Clean the sensor and the sensor shield, then reinstall the sensor. Also, install a proper filter (i.e. sintered or coalescing element).
Sensor is corroded	**Response:** Reads too wet or too dry **Action:** Return probe to factory for evaluation.
Stream particles causing abrasion.	**Response:** Reads too wet or too dry. **Action:** Return probe to factory for evaluation.

4.3 Replacing/Recalibrating Moisture Probes

For maximum accuracy, moisture probes should be returned to the factory for recalibration every 6–12 months, depending on the application. Under very severe conditions, more frequent calibrations are recommended However, under very mild conditions, less frequent calibrations are necessary. Contact a GE applications engineer for your specific recommended calibration frequency

All new or recalibrated moisture probes must be installed in accordance with the instructions in Chapter 2, *Installation*.

IMPORTANT: *To maintain good contact at the terminal block and to avoid damaging the pins on the wiring connector, pull the connector straight off (not at an angle) the terminal block. Then, make the cable connections while the connector is off the unit. Finally, after the wiring is complete, push the connector straight onto the terminal block (not at an angle).*

After the probe has been installed and wired, enter the probe calibration curve data as described in Chapter 3, *Operation and Programming*. Each probe is shipped with its own *Calibration Data Sheet*, which includes the serial number for that probe.

4.4 Cleaning the MTS6 Front Panel

When necessary, use the procedure below to clean the front panel. You will need the following:

- Clean, lint free cloth
- Cleaning solution (soap and warm water)

To clean the front panel:

1. Moisten the cloth with the cleaning solution.
2. Gently wipe the front panel clean.
3. Use a dry cloth to dry the front panel.

Chapter 5. Specifications

5.1 Electronics

Input:

moisture signal from GE thin-film aluminum oxide moisture sensor on an M Series probe or a VeriDri probe

Intrinsic Safety:

external safety barrier for moisture input (optional)

Analog Output:

single, isolated recorder output for dew point,
internally optically isolated, 10-bit (0.1%) resolution

0–2 V: 10 kΩ minimum load resistance
0–20 mA: 400 Ω maximum series resistance
4–20 mA: 400 Ω maximum series resistance

Outputs are user-programmable within the range of the instrument and the corresponding probe.

Alarm Relays:

1 fault alarm and 2 programmable high/low alarms:

	Standard
Form C SPDT Relays:	3A @ 250VAC
	3A @ 30VDC

Standard designs are available for the high/low alarms, set to trip at any level within the range of the instrument, and programmable from the front panel.

5.1 Electronics (cont.)

Alarm Setpoint Repeatability:

±0.1°C dew point

MicroSD:

Supports MicroSD and MicroSDHC (high capacity) cards up to 32 GB, with individual logs up to 4 GB in size. The factory-supplied card has a capacity of 2 GB (2,000,000,000 bytes), or over 45 million average log records.

Note: *The* **MTS6** *unit has been fully tested with* SanDisk MicroSD/SDHC and Kingston MicroSD *cards. It is therefore recommended that the customer use* SanDisk *or* Kingston *brand cards.*

Configurations:

panel-mount, PC board

Display:

128 x 64 matrix LCD display with LED backlight

Front Panel:

weatherproof membrane front panel display/keypad meets **NEMA 4** and **IP66** requirements (panel-mount version only)

Display Functions:

dew point temperature °C or °F, or sensor signal MH or FH

Input Power:

option 1, AC: universal power 100-240 VAC @ 50-60 Hz
option 2, DC: 24 VDC nominal ±10%

Power Dissipation:

AC units: 5 W maximum
DC units: 5 W maximum

5.1 Electronics (cont.)

Temperature:

operating: –20° to +60°C
storage: –40° to +70°C

Warm-Up Time:

meets specified accuracy within three minutes

Dimensions:

panel-mount: 2.24 x 4.09 x 4.79 in. (H x W x D)
(57 x 104 x 121.78 mm)
cutout required: 1.81 x 3.69 in. (H x W)
(46 x 93.6 mm)
board-mount: 5.9 x 5.1 x 2.2 in. (H x W x D)
(150 x 130 x 56 mm)

European Compliance:

complies with EMC Directive 2004/108/EC and 2006/95/EC Low Voltage Directive (Installation Category II, Pollution Degree II)

5.2 Moisture Measurement

Sensor Type:

thin-film aluminum oxide moisture sensor probe

Moisture Probe Compatibility:

compatible with all GE M-Series aluminum oxide moisture probes and VeriDri transmitters

Traceability:

All moisture probe calibrations are traceable to National Institute of Standards and Technology (NIST) standards or National Physical Lab, U.K. (NPL) as accredited by Irish National Accreditation Board (INAB).

5.2 Moisture Measurement (cont.)

Probe Cable Length:

M Series: 2,000 ft (600 m) maximum
VeriDri: 1,000 ft (300 m) maximum

Moisture Probe Pressure Rating:

M1: 5 microns Hg to 75 psig (5 barg)
M2: 5 microns Hg to 5,000 psig (345 barg)
VeriDri: 5 microns Hg to 5,000 psig (345 barg)

Dew/Frost Point Temperature:

Overall Calibration Range:
–110° to 60°C

Available Calibration Range Options:
Standard: –80° to 20°C with data to –110°C
Extended High: –80° to 60°C with data to –110°C

Accuracy:
±2°C from –65° to 60°C
±3°C from –110° to -66°C

Repeatability:
±0.5°C from –65° to 60°C
±1.0°C from –110° to -66°C

Appendix A. Outline and Installation Drawings

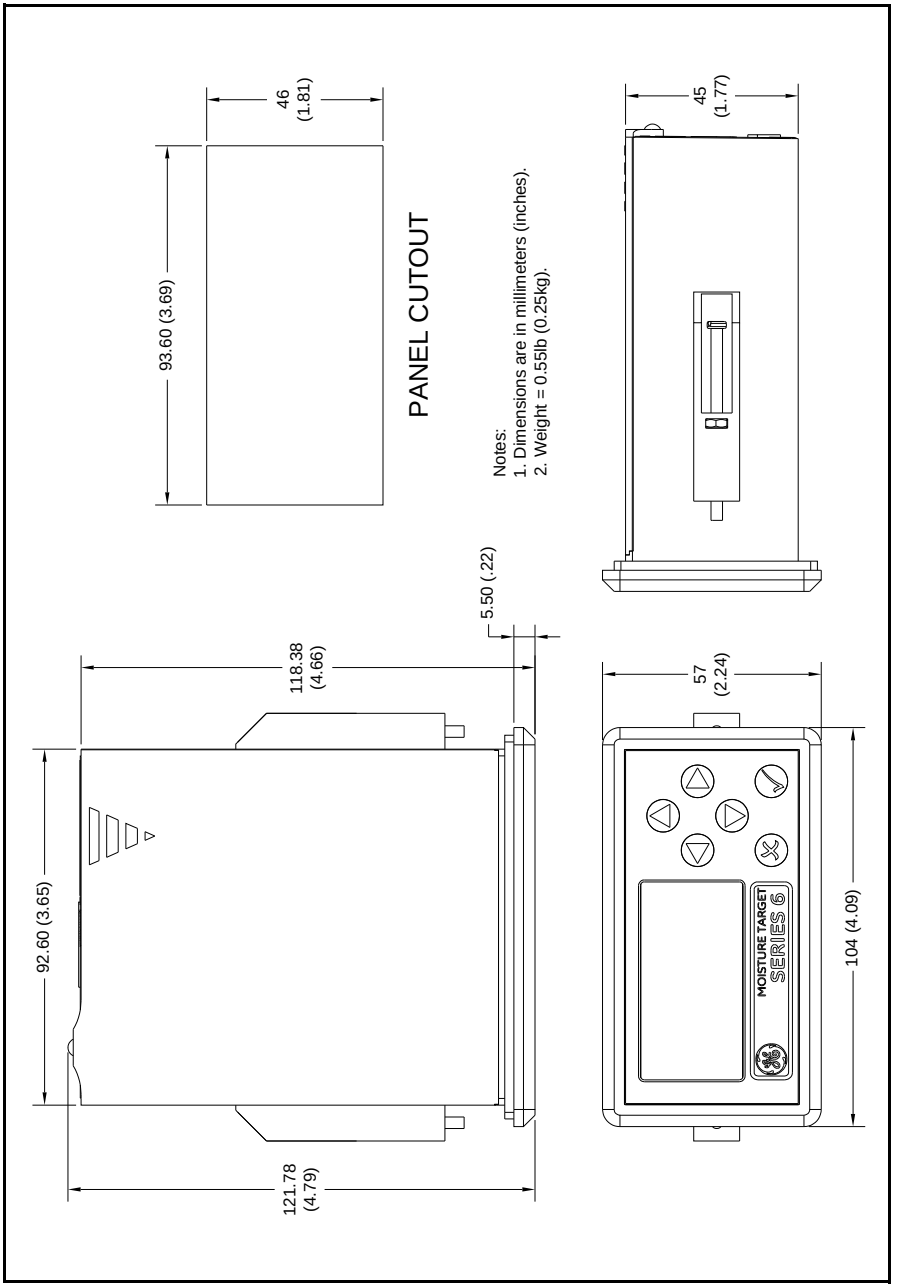

Figure 46: MTS6 Outline and Mounting (ref. dwg #712-1550)

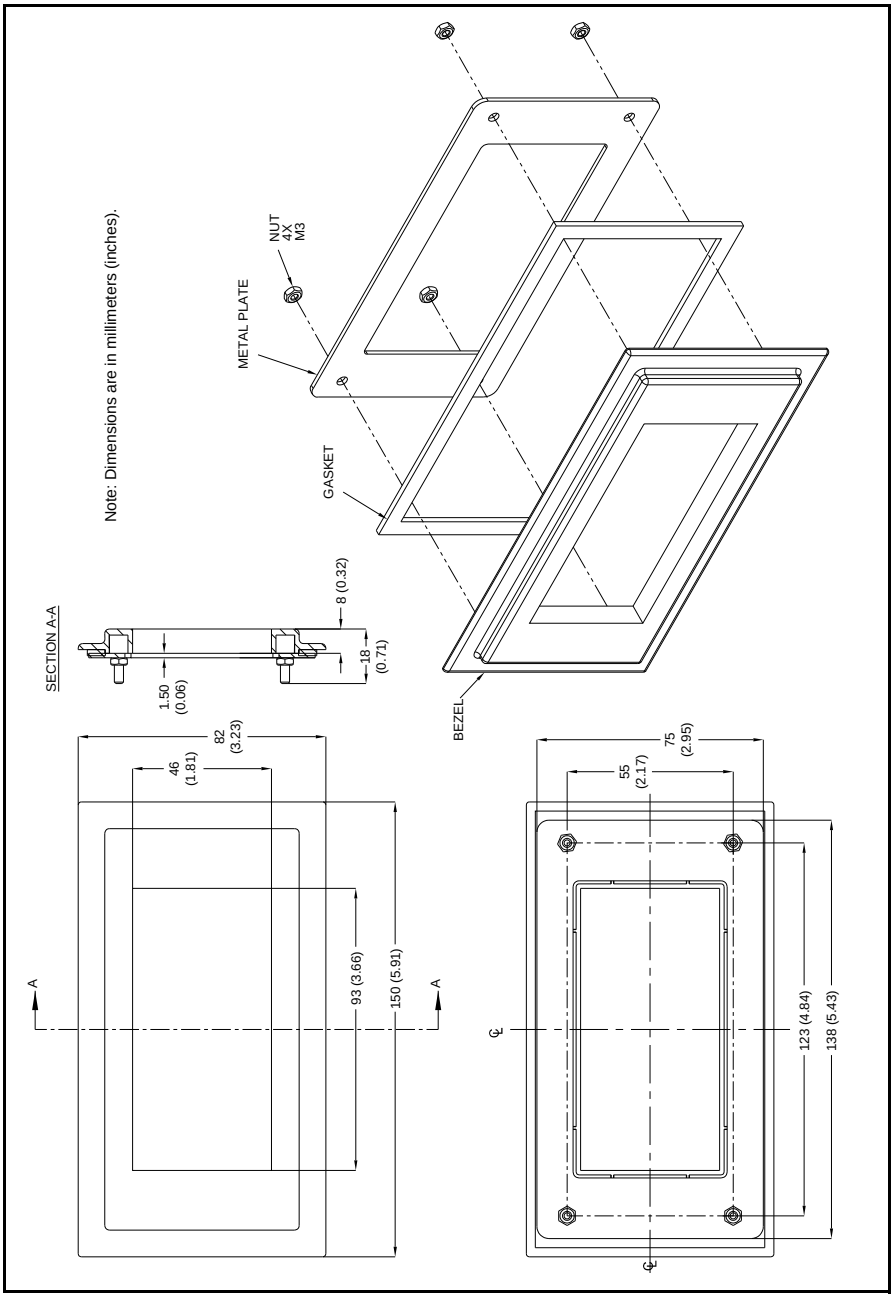

Figure 47: MTS6 Optional Adapter Plates (ref. dwg #705-1297)

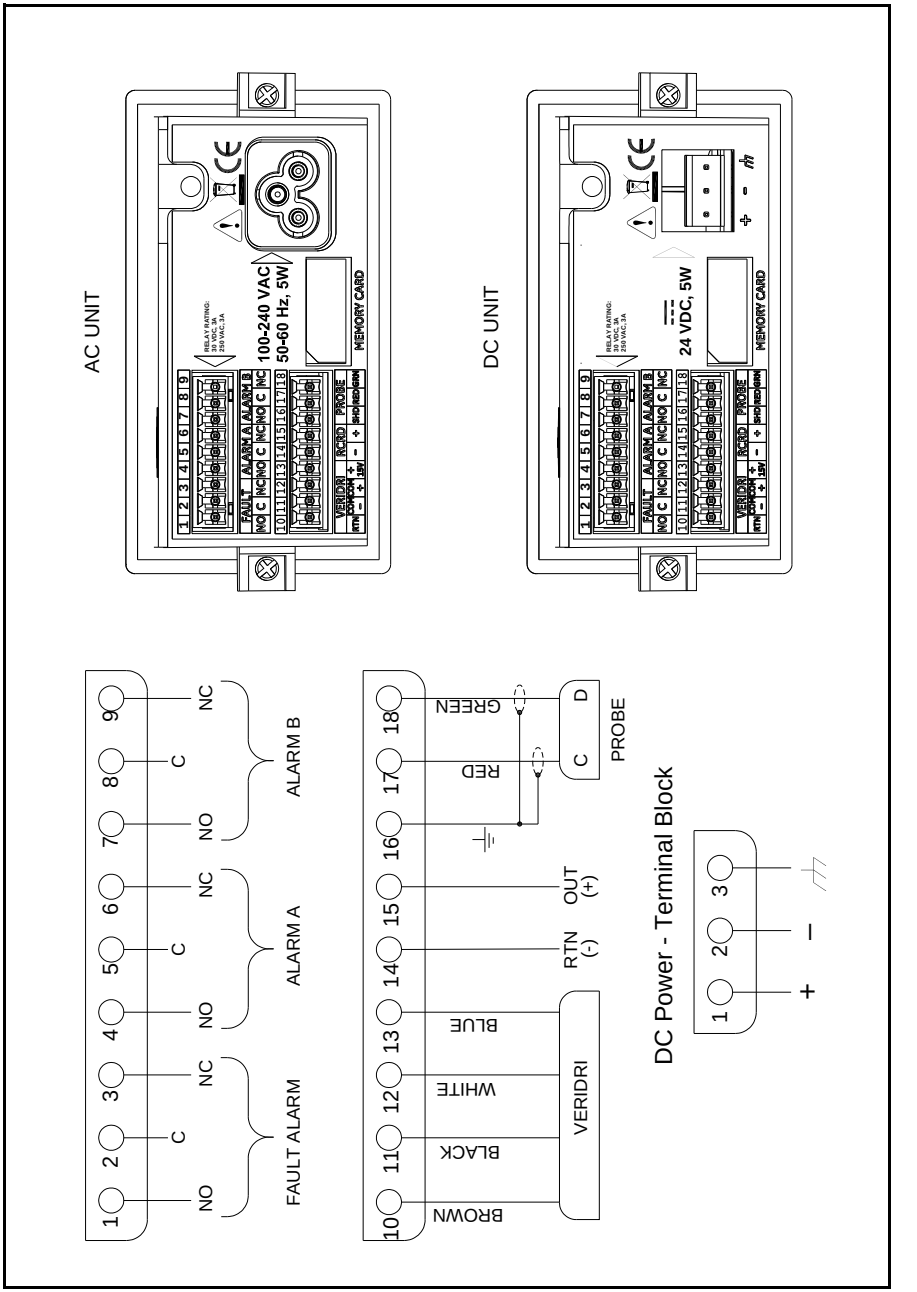

Figure 48: Interconnection Diagram (ref. dwg #702-1015)

Appendix B. Menu Maps

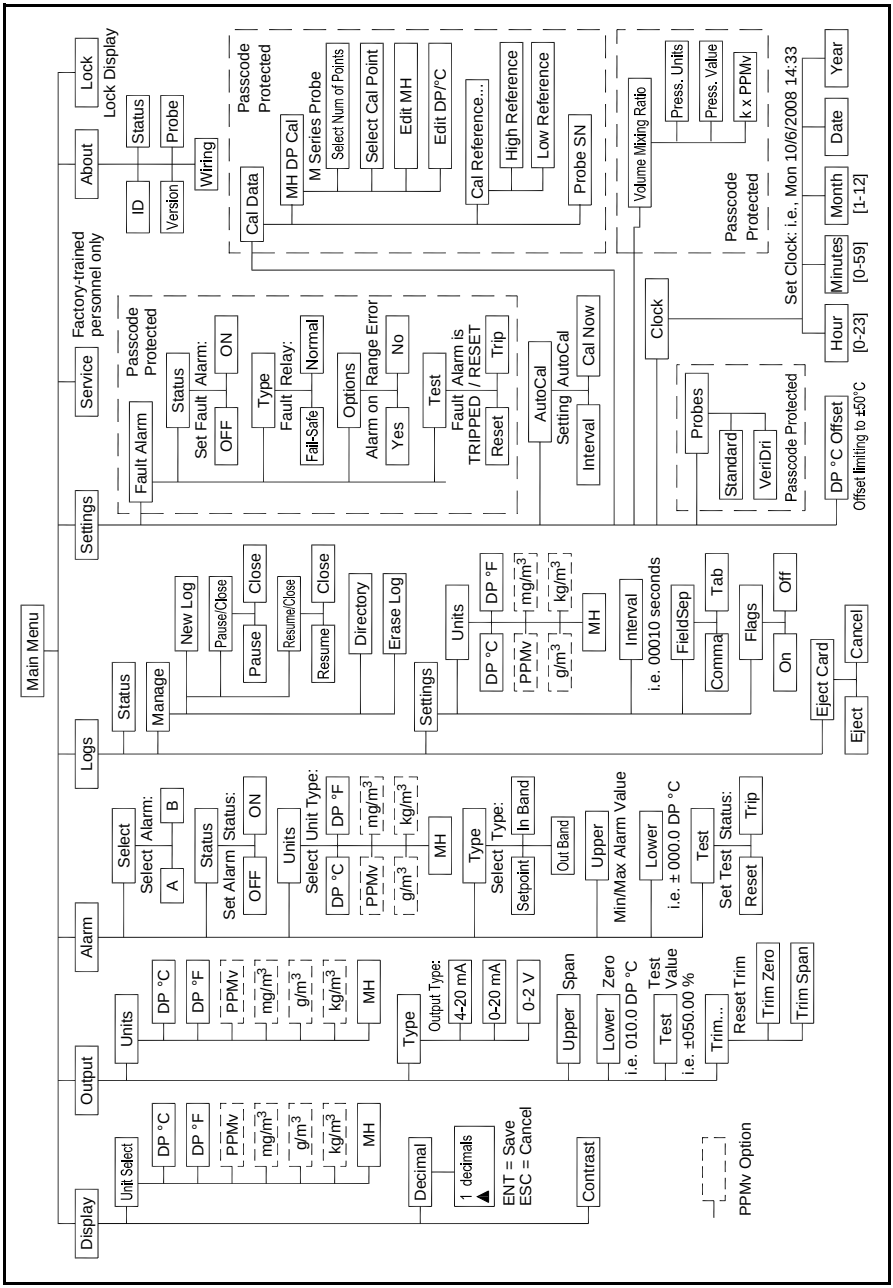

Figure 49: Main Menu Map Using M Series Probe

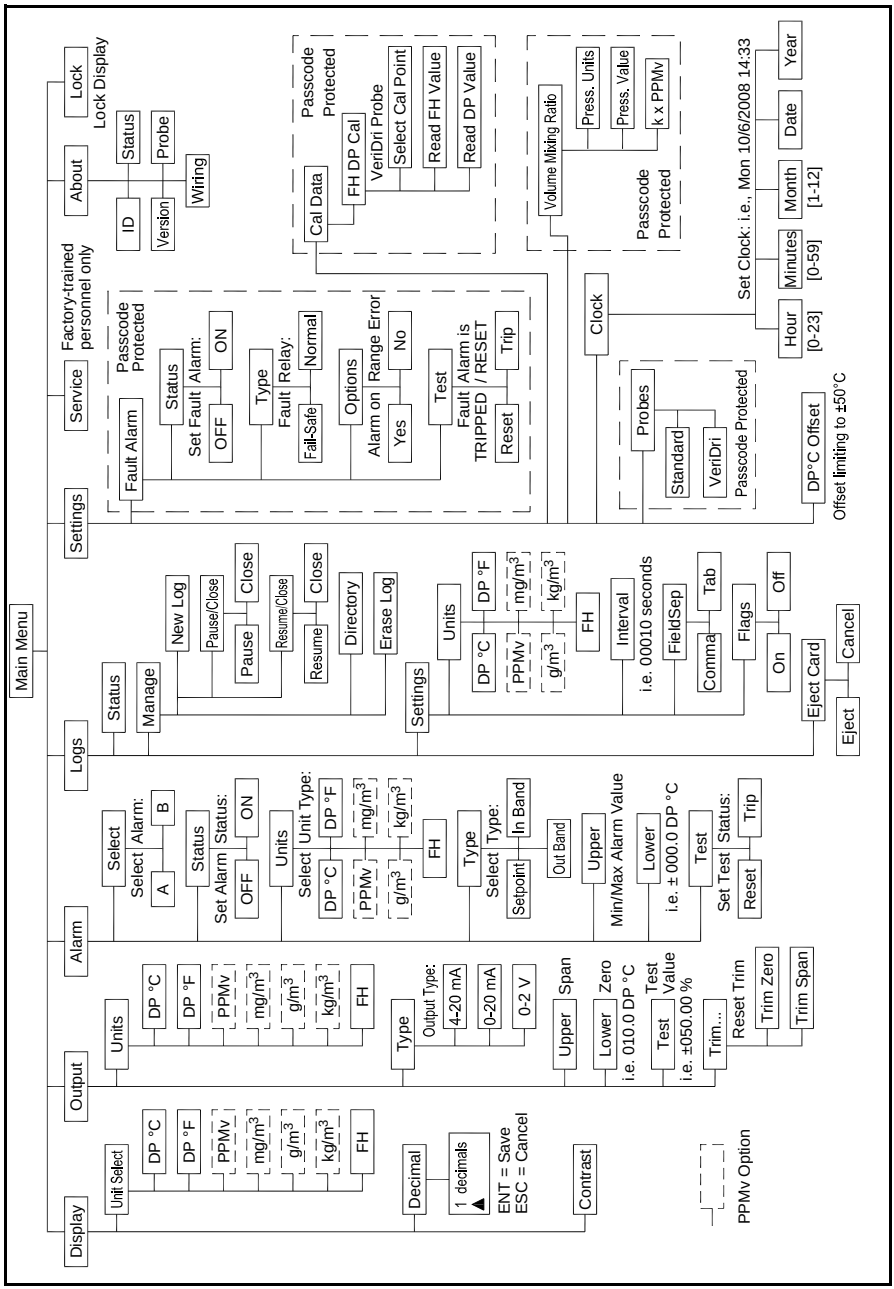

Figure 50: Main Menu Map Using VeriDri Probe

[no content intended for this page

Appendix C. Reading the MicroSD Card

C.1 Removing the Card

IMPORTANT: *Before removing the MicroSD Card, refer to section* 3.5.4 Ejecting the SD Card *on page 55, to first stop the data log.*

1. Locate the memory card in the lower center of the rear panel and pull the flexible cover from the left. The cover hangs from the right side (see Figure 51 and Figure 52).

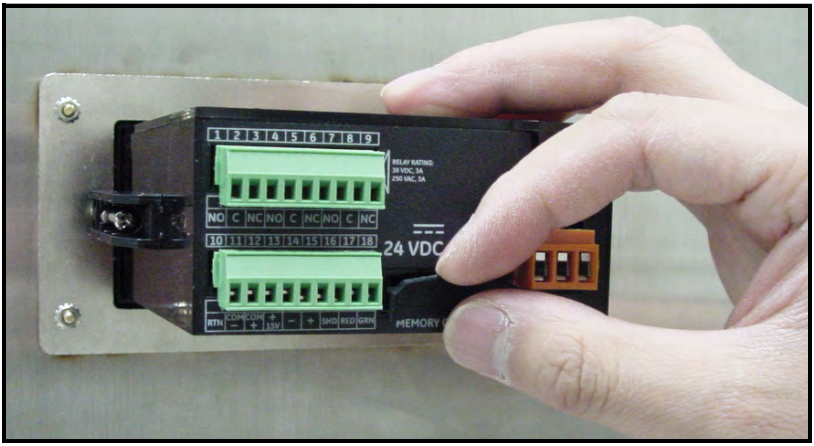

Figure 51: Pulling the Flexible Cover

1 2 3 4 5 6 7 8 9
RELAY RATING:
30 VDC, 3A
250 VAC, 3A
NO C NC NO C NC NO C NC
10 11 12 13 14 15 16 17 18
24 VDC, 5W
RTN COM COM + 15V – + SHD RED GRN
MEMORY C
CE
+ – ⏚

Figure 52: The Opened Memory Card Holder

C.1 Removing the Card (cont.)

2. Push in the memory card until it clicks and pull it from the **MTS6** chassis (see Figure 53 and Figure 54).

Figure 53: Pushing in on the MicroSD Card

Figure 54: Removing the MicroSD Card

C.1 Removing the Card (cont.)

3. Plug the memory card into a card reader and insert the reader into a computer (see Figure 55 and Figure 56).

Figure 55: Plugging the Reader into a PC

Figure 56: The Reader Plugged In

C.2 Accessing the Files

1. From the PC, open My Computer and find the device (see Figure 57).

Figure 57: Locating the Device

2. Click on Removable Disk and a screen similar to Figure 58 on page 101 appears.

C.2 Accessing the Files (cont.)

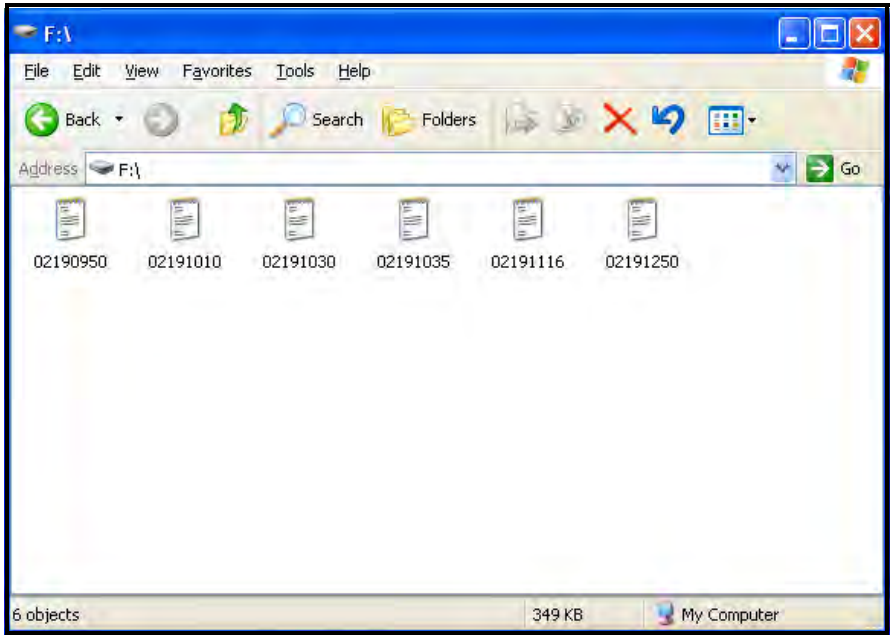

Figure 58: List of Log Files

3. Click on the desired file and a screen similar to Figure 59 appears.

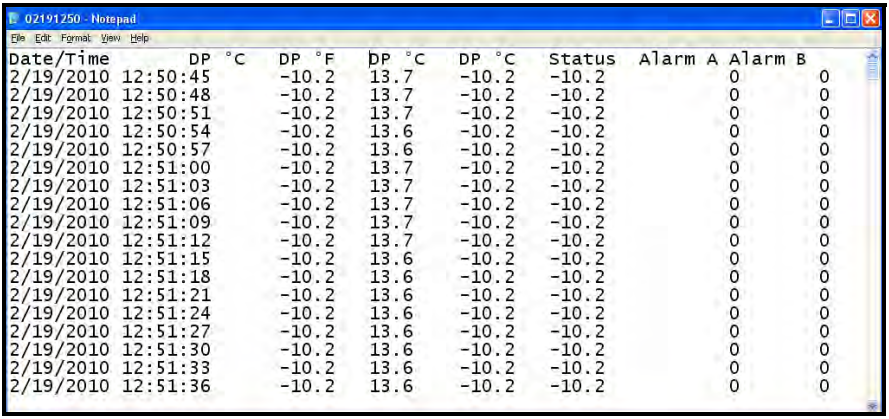
02191250 - Notepad

File Edit Format View Help

Date/Time	DP °C	DP °F	DP °C	DP °C	Status	Alarm A	Alarm B
2/19/2010 12:50:45	-10.2	13.7	-10.2	-10.2		0	0
2/19/2010 12:50:48	-10.2	13.7	-10.2	-10.2		0	0
2/19/2010 12:50:51	-10.2	13.7	-10.2	-10.2		0	0
2/19/2010 12:50:54	-10.2	13.6	-10.2	-10.2		0	0
2/19/2010 12:50:57	-10.2	13.6	-10.2	-10.2		0	0
2/19/2010 12:51:00	-10.2	13.7	-10.2	-10.2		0	0
2/19/2010 12:51:03	-10.2	13.7	-10.2	-10.2		0	0
2/19/2010 12:51:06	-10.2	13.7	-10.2	-10.2		0	0
2/19/2010 12:51:09	-10.2	13.7	-10.2	-10.2		0	0
2/19/2010 12:51:12	-10.2	13.7	-10.2	-10.2		0	0
2/19/2010 12:51:15	-10.2	13.6	-10.2	-10.2		0	0
2/19/2010 12:51:18	-10.2	13.6	-10.2	-10.2		0	0
2/19/2010 12:51:21	-10.2	13.6	-10.2	-10.2		0	0
2/19/2010 12:51:24	-10.2	13.6	-10.2	-10.2		0	0
2/19/2010 12:51:27	-10.2	13.6	-10.2	-10.2		0	0
2/19/2010 12:51:30	-10.2	13.6	-10.2	-10.2		0	0
2/19/2010 12:51:33	-10.2	13.6	-10.2	-10.2		0	0
2/19/2010 12:51:36	-10.2	13.6	-10.2	-10.2		0	0

Figure 59: Log File Notepad

C.2 Accessing the Files (cont.)

4. Log files can be opened with a text editor. Open Excel and select Open.

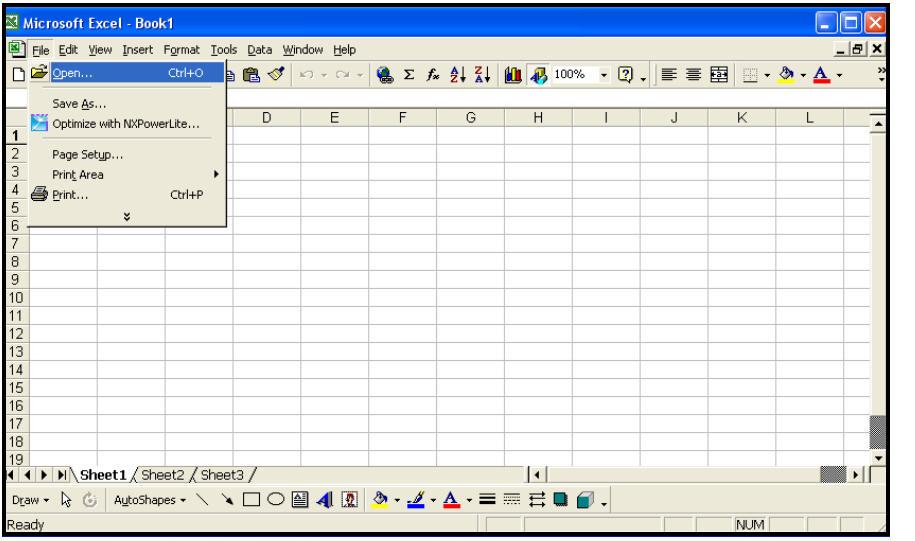

Figure 60: Importing Log Files to Excel

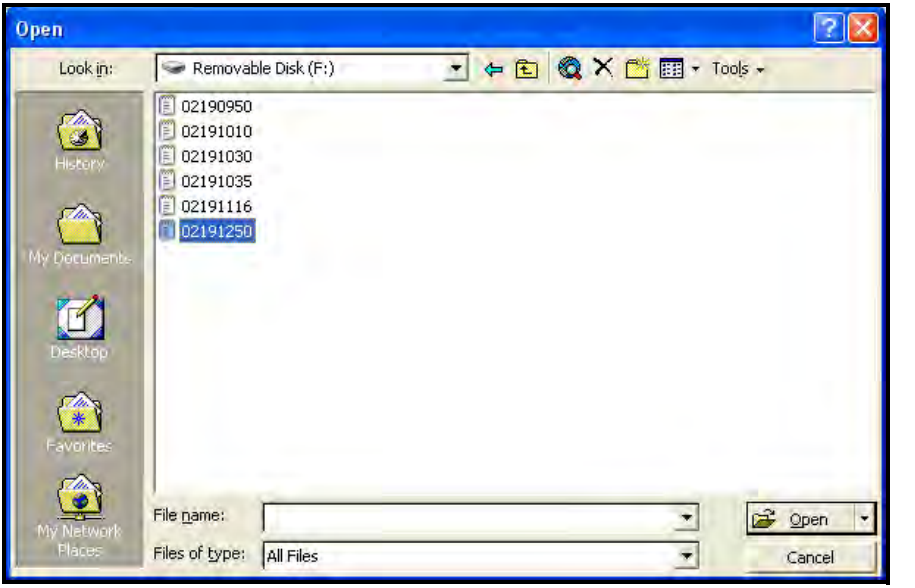

Figure 61: Selecting the Log File to Open

C.3 Setting Up the Files

5. Open the file by clicking twice on the number.

Note: *Ensure that the file type equals all types.*

The following screen appears (see Figure 62).

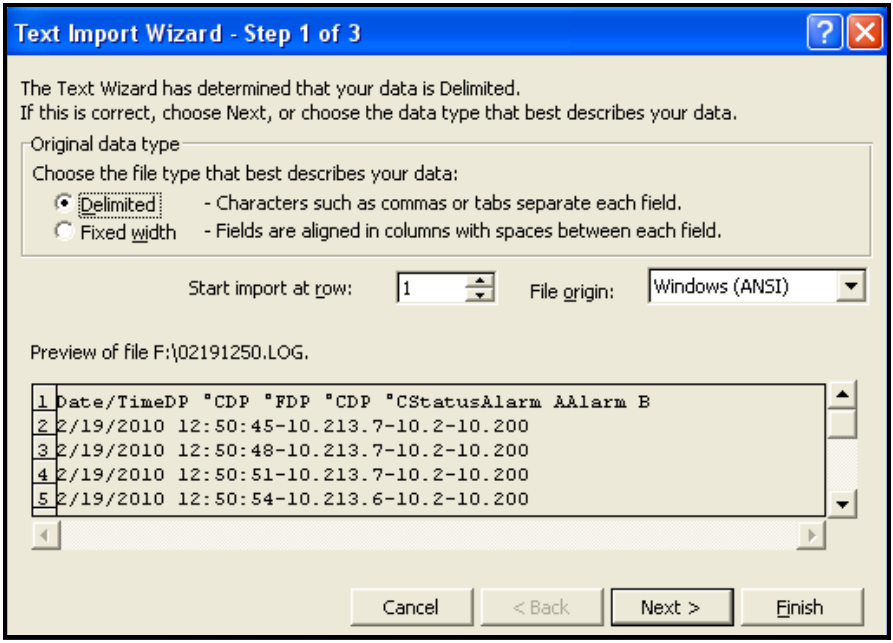
Text Import Wizard - Step 1 of 3
The Text Wizard has determined that your data is Delimited.
If this is correct, choose Next, or choose the data type that best describes your data.
Original data type
Choose the file type that best describes your data:
Delimited - Characters such as commas or tabs separate each field.
Fixed width - Fields are aligned in columns with spaces between each field.
Start import at row: 1
File origin: Windows (ANSI)
Preview of file F:\02191250.LOG.
1 Date/TimeDP °CDP °FDP °CDP °CStatusAlarm AAlarm B
2 2/19/2010 12:50:45-10.213.7-10.2-10.200
3 2/19/2010 12:50:48-10.213.7-10.2-10.200
4 2/19/2010 12:50:51-10.213.7-10.2-10.200
5 2/19/2010 12:50:54-10.213.6-10.2-10.200
Cancel
< Back
Next >
Finish

Figure 62: Excel Import Wizard 1

6. Follow the directions on the screen, make changes if necessary, and click on Next >. The following screen appears (see Figure 63 on page 104).

C.3 Setting Up the Files (cont.)

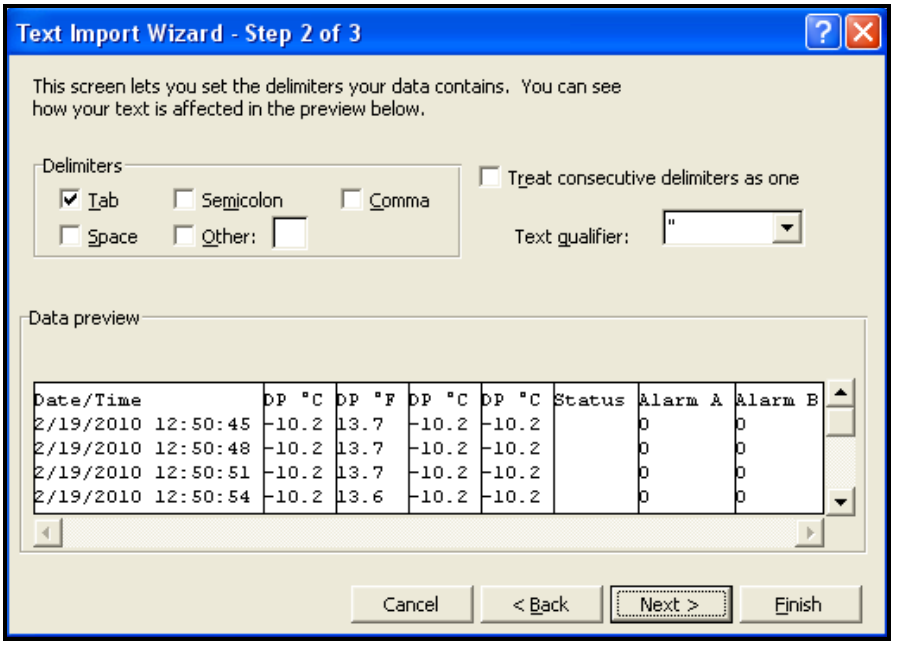
Text Import Wizard - Step 2 of 3
This screen lets you set the delimiters your data contains. You can see how your text is affected in the preview below.
Delimiters
Tab
Semicolon
Comma
Space
Other:
Treat consecutive delimiters as one
Text qualifier:
"
Data preview
Date/Time DP °C DP °F DP °C DP °C Status Alarm A Alarm B
2/19/2010 12:50:45 -10.2 13.7 -10.2 -10.2 0 0
2/19/2010 12:50:48 -10.2 13.7 -10.2 -10.2 0 0
2/19/2010 12:50:51 -10.2 13.7 -10.2 -10.2 0 0
2/19/2010 12:50:54 -10.2 13.6 -10.2 -10.2 0 0
Cancel
< Back
Next >
Finish

Figure 63: Excel Import Wizard 2

7. Set the desired data delimiters, and click on Next >. The following screen appears (see Figure 64 on page 105).

C.3 Setting Up the Files (cont.)

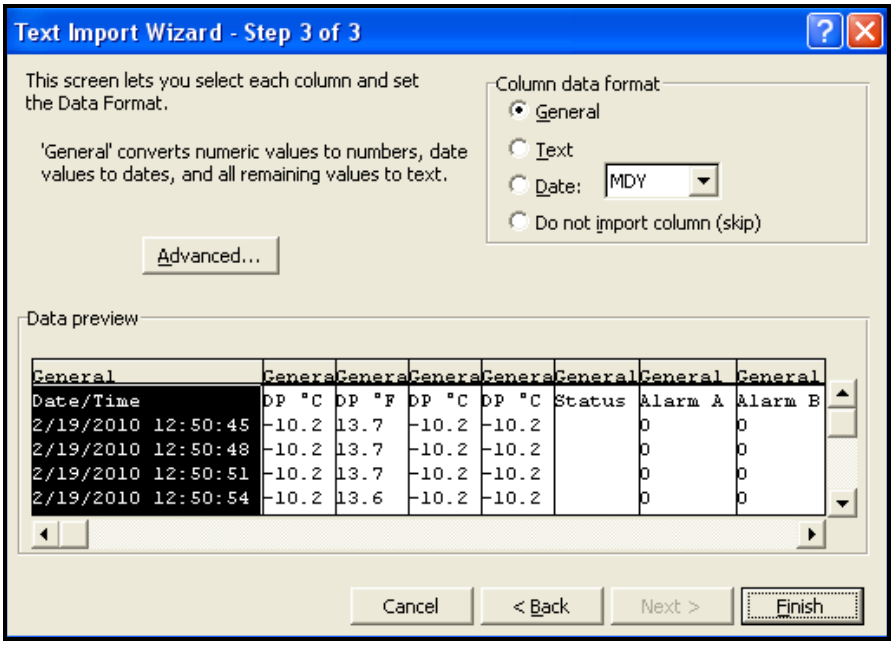
Text Import Wizard - Step 3 of 3
This screen lets you select each column and set the Data Format.
'General' converts numeric values to numbers, date values to dates, and all remaining values to text.
Advanced...
Column data format
General
Text
Date: MDY
Do not import column (skip)
Data preview
General Genera Genera Genera Genera General General General
Date/Time DP °C DP °F DP °C DP °C Status Alarm A Alarm B
2/19/2010 12:50:45 -10.2 13.7 -10.2 -10.2 0 0
2/19/2010 12:50:48 -10.2 13.7 -10.2 -10.2 0 0
2/19/2010 12:50:51 -10.2 13.7 -10.2 -10.2 0 0
2/19/2010 12:50:54 -10.2 13.6 -10.2 -10.2 0 0
Cancel
< Back
Next >
Finish

Figure 64: Excel Import Wizard 3

8. Select each column and set the data format for it (see Figure 64).
9. When the setup is complete, click on Finish, and a screen similar to Figure 65 on page 106 appears.

C.3 Setting Up the Files (cont.)

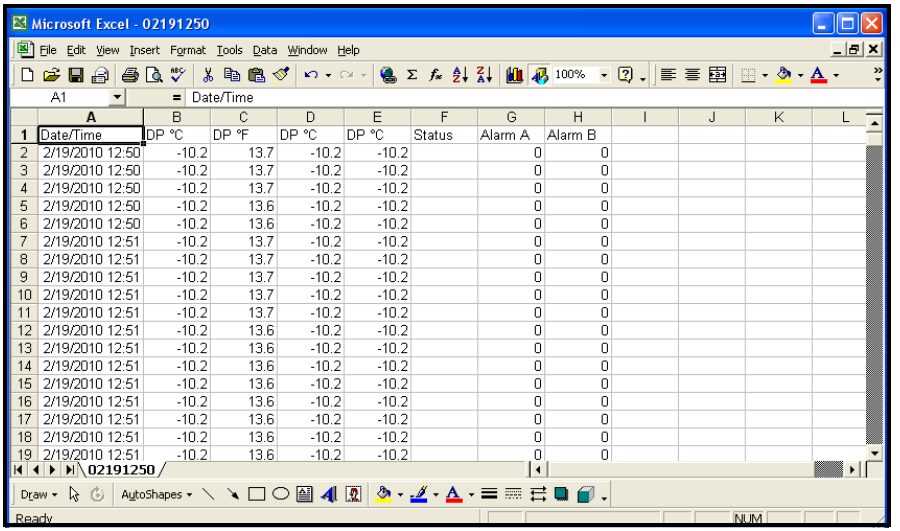

	A	B	C	D	E	F	G	H
1	Date/Time	DP °C	DP °F	DP °C	DP °C	Status	Alarm A	Alarm B
2	2/19/2010 12:50	-10.2	13.7	-10.2	-10.2		0	0
3	2/19/2010 12:50	-10.2	13.7	-10.2	-10.2		0	0
4	2/19/2010 12:50	-10.2	13.7	-10.2	-10.2		0	0
5	2/19/2010 12:50	-10.2	13.6	-10.2	-10.2		0	0
6	2/19/2010 12:50	-10.2	13.6	-10.2	-10.2		0	0
7	2/19/2010 12:51	-10.2	13.7	-10.2	-10.2		0	0
8	2/19/2010 12:51	-10.2	13.7	-10.2	-10.2		0	0
9	2/19/2010 12:51	-10.2	13.7	-10.2	-10.2		0	0
10	2/19/2010 12:51	-10.2	13.7	-10.2	-10.2		0	0
11	2/19/2010 12:51	-10.2	13.7	-10.2	-10.2		0	0
12	2/19/2010 12:51	-10.2	13.6	-10.2	-10.2		0	0
13	2/19/2010 12:51	-10.2	13.6	-10.2	-10.2		0	0
14	2/19/2010 12:51	-10.2	13.6	-10.2	-10.2		0	0
15	2/19/2010 12:51	-10.2	13.6	-10.2	-10.2		0	0
16	2/19/2010 12:51	-10.2	13.6	-10.2	-10.2		0	0
17	2/19/2010 12:51	-10.2	13.6	-10.2	-10.2		0	0
18	2/19/2010 12:51	-10.2	13.6	-10.2	-10.2		0	0
19	2/19/2010 12:51	-10.2	13.6	-10.2	-10.2		0	0

Figure 65: Successful Excel Import

The log file is now properly formatted for graphing or analysis.

Appendix D. The Non-Enclosure MTS6 Package

Caution! Risk of electric shock.

1. Mount the MTS6 package in an enclosed panel where no hazardous live wires are exposed. See Figure 66 for dimensions.

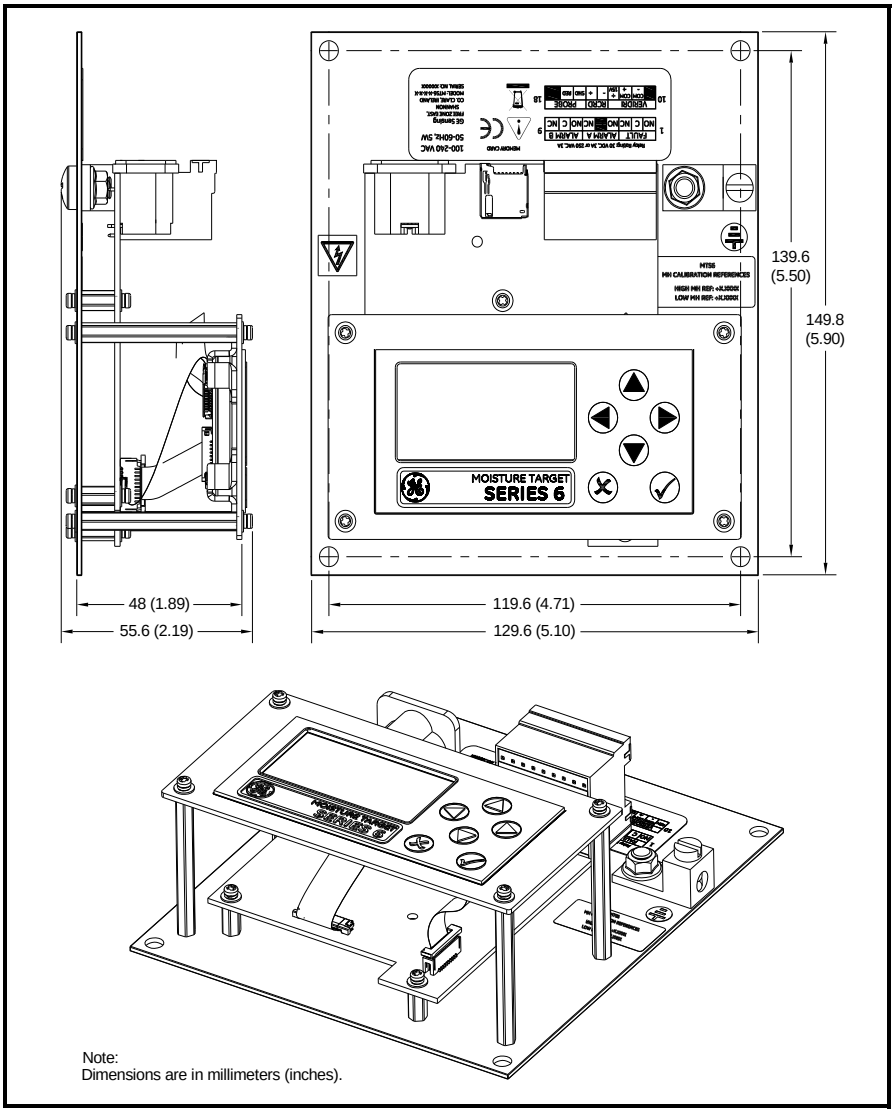

Figure 66: MTS6 Non-Enclosure Package Outline (ref. dwg #712-1687)

2. Ground the MTS6 baseplate using the provided ground lug.
3. Connect the MTS6 unit according to the local electrical code.

A

Adapter Plate
- Gasket . . . 12
- Inserting . . . 13

Adapter Plates, Optional . . . 91
Alarm Relays . . . 85
Alarms
- Changing the Lower Span . . . 46
- Changing the Upper Span . . . 46
- Fault . . . 29
- How Alarm Types Work . . . 45
- Resetting Test Status . . . 47
- Selecting a Type . . . 44
- Selecting an Output . . . 43
- Selecting Status . . . 43
- Selecting Units . . . 44
- Setting Up . . . 43
- Wiring . . . 27

Analog Output . . . 85
Autocal, Setting . . . 59

B

Backing Plate, Applying . . . 13
Brackets, Mounting . . . 10

C

Cable, Standard Probe . . . 21
Calibration
- MH/DP . . . 60
- Probe . . . 83
- Reading the DP Value . . . 64
- Reading the FH Value . . . 64
- Selecting the Calibration Point . . . 61, 63
- Setting Data 1 . . . 60
- Setting Data 2 . . . 63
- Setting Number of Points . . . 61
- Setting the Dewpoint Calibration . . . 62
- Setting the MH Calibration . . . 62

Contrast, Setting . . . 37

D

Decimal Places, Setting 37
Dimensions 87, 90, 107
Display
    Gasket 9
    Setting Up 36
DP °C Offset, Setting 74

E

Electronics 85
Electronics Unit
    Mounting 8
    Wiring Connections 18, 92
Environmental Compliance iv
European Compliance 87

F

Fault Alarm
    Connecting 29
    Description 29
    Setting 56
    Setting Options 58
    Testing 58
Fault Relay Type, Setting 57

G

Gasket 9
    Adapter Plate 12

I

ID, Checking 75
Information, Setting 56
Input 85
Input Power 86
Installation
- Adapter Plate Gasket 12
- Applying the Backing Plate 13
- Gasket 9
- Inserting the Adapter Plate 13
- Mounting Brackets 10
- Panel Mount 15
- Probe 17
- Securing Plate Assembly 14

Interconnection Diagram 92
Intrinsic Safety 85

L

Locking the Menu 77
Logs
- Checking the Status 47
- Creating 51
- Deleting Numbers 54
- Managing Files 51
- Setting a Field Separator 50
- Setting Status Flags 50
- Setting the Interval 49
- Setting Units 48
- Setting Up 47
- Settings Menu 48
- Viewing Numbers 53

M

M Series Probe 2
Menu Map, Main Menu 94, 95
Menu, Locking 77
Menus, Accessing 34
MicroSD Card
    Accessing the Files 100
    Reading 97
    Removing 97
    Setting Up the Files 103
Moisture Meaasurement 87
Mounting
    Brackets 10
    Electronics Unit 8
    MTS-6 into Panel Cutout 9
    Non-Enclosure Package 107
    Panel 15
    Sample System 17
    Securing MTS-6 to Panel 11
MTS-6
    Panel-Mounted 15
    PC Board Access 4, 5
    Removing the Top Cover 4, 5

N

Non-Enclosure Package 107
Numeric Values, Entering 35

O

Offset, Constant DP °C 74
Operation 33
Outline and Mounting 90, 107
Output
    Changing the Lower Span 40
    Changing the Upper Span 39
    Selecting the Type 39
    Selecting Units 38
    Setting Up 38
    Testing 40
    Trimming 41

P

Passcode, Entering 56
PC Board, S1 Location 7
Plate Assembly, Installing 14
Power Cable
    AC Connection 30
    DC Connection 31
Power Dissipation 86
Primary Units, Selecting 36
Probe
    Checking 76
    Inserting Standard Connector 23
    Installing 17
    M Series 2
    Mounted in Sample Cell 18
    Replacing/Recalibrating 83
    Serial Number, Entering 67
    Standard Cable Connections 21
    Standard Wiring 21
    Standard Wiring to Connector 23
    VeriDri 2
    VeriDri Wiring 24
Problems, Troubleshooting 81
Programming 33

R

Recalibrating the Probe 83
Recorder Output Wiring 4
Replacing the Probe 83
Return Policy 122

S

Safety
- Auxiliary Equipment . . . iii
- General Issues . . . iii
- Personal Equipment . . . iv

Sample Cell . . . 17
Sample System, Mounting . . . 17
SD Card, Ejecting . . . 55
Software Version, Checking . . . 76
Specifications . . . 85
- Alarm Relays . . . 85
- Analog Output . . . 85
- Dimensions . . . 87
- Electronics . . . 85
- European Compliance . . . 87
- Input . . . 85
- Input Power . . . 86
- Intrinsic Safety . . . 85
- Moisture Measurement . . . 87
- Power Dissipation . . . 86
- Temperature . . . 87
- Warm-Up Time . . . 87

Starting Up . . . 33
Status, Checking . . . 75
Switch S1 . . . 7

T

Temperature . . . 87
- Display Range . . . 1
- Operating Range . . . 1

Time, Resetting . . . 70
Troubleshooting Guide . . . 81

V

VeriDri Probe . . . 2
Voltage, Available Options . . . 1

W

Warm-Up Time 87
Warranty 121
Wiring
- AC Power Cable 30
- Alarms 27
- Checking 77
- Connection Diagram 92
- Connection Diagram, AC Version 19
- Connection Diagram, DC Version 19
- DC Power Cable 31
- Non-Enclosure Package 108
- Recorder Output 4
- Standard Probe 21, 23
- VeriDri Probe 24

[no content intended for this page]

Warranty

Each instrument manufactured by GE Sensing is warranted to be free from defects in material and workmanship. Liability under this warranty is limited to restoring the instrument to normal operation or replacing the instrument, at the sole discretion of GE Sensing. Fuses and batteries are specifically excluded from any liability. This warranty is effective from the date of delivery to the original purchaser. If GE Sensing determines that the equipment was defective, the warranty period is:

- one year from delivery for electronic or mechanical failures
- one year from delivery for sensor shelf life

If GE Sensing determines that the equipment was damaged by misuse, improper installation, the use of unauthorized replacement parts, or operating conditions outside the guidelines specified by GE Sensing, the repairs are not covered under this warranty.

The warranties set forth herein are exclusive and are in lieu of all other warranties whether statutory, express or implied (including warranties or merchantability and fitness for a particular purpose, and warranties arising from course of dealing or usage or trade).

Return Policy

If a GE Sensing instrument malfunctions within the warranty period, the following procedure must be completed:

1. Notify GE Sensing, giving full details of the problem, and provide the model number and serial number of the instrument. If the nature of the problem indicates the need for factory service, GE Sensing will issue a RETURN AUTHORIZATION NUMBER (RAN), and shipping instructions for the return of the instrument to a service center will be provided.
2. If GE Sensing instructs you to send your instrument to a service center, it must be shipped prepaid to the authorized repair station indicated in the shipping instructions.
3. Upon receipt, GE Sensing will evaluate the instrument to determine the cause of the malfunction.

Then, one of the following courses of action will then be taken:

- If the damage is covered under the terms of the warranty, the instrument will be repaired at no cost to the owner and returned.
- If GE Sensing determines that the damage is not covered under the terms of the warranty, or if the warranty has expired, an estimate for the cost of the repairs at standard rates will be provided. Upon receipt of the owner's approval to proceed, the instrument will be repaired and returned.

GE
Sensing

DECLARATION OF CONFORMITY

DOC-0006, Rev. A

We,

GE Sensing
1100 Technology Park Drive
Billerica, MA 01821
USA

declare under our sole responsibility that the

Moisture Target™ Series 6 Hygrometer

to which this declaration relates, is in conformity with the following standards:

- EN 61326-1: 2006, Class A, Table 2, Industrial Locations
- EN 61326-2-3: 2006
- EN 61010-1: 2001, Overvoltage Category II, Pollution Degree 2

following the provisions of the 2004/108/EC EMC and 2006/95/EC Low Voltage Directives.

The unit listed above and any ancillary equipment supplied with it do not bear CE marking for the Pressure Equipment Directive, as they are supplied in accordance with Article 3, Section 3 (sound engineering practices and codes of good workmanship) of the Pressure Equipment Directive 97/23/EC for DN<25.

Billerica - August 2010
Issued

Mr. Gary Kozinski
Certification & Standards, Lead Engineer

Customer Support Centers

U.S.A.

The Boston Center
1100 Technology Park Drive
Billerica, MA 01821
U.S.A.
Tel: 800 833 9438 (toll-free)
978 437 1000
E-mail: sensing@ge.com

Ireland

Sensing House
Shannon Free Zone East
Shannon, County Clare
Ireland
Tel: +35 361 470291
E-mail: gesensingsnnservices@ge.com

An ISO 9001:2008 Certified Company

www.ge-mcs.com/en/about-us/quality.html

www.ge-mcs.com

©2011 General Electric Company. All rights reserved.
Technical content subject to change without notice.

910-291 Rev. D